Reserve Study Update Pine Ridge Plantation CDD Middleburg, Florida



Prepared for FY 2024 Report Date: May 18, 2024





May 18, 2024

Ms. Marilee Giles, District Manager GMS 475 West Town Place, Suite 114 St. Augustine, Florida 32092

Re: Pine Ridge Plantation CDD

Dear Ms. Giles:

Community Advisors is pleased to provide this Revised Reserve Study report for the above referenced Association. We have completed the adjustments you requested and have updated your funding plan. We recommend updating your study every 2 years to keep your information current with changing replacement cost, interest and inflation rates.

It has been a pleasure serving you and please let me know if you have any questions or concerns.

Respectively submitted,

CRShamand

Charles R. Sheppard RS PRA CCI

Professional Reserve Analyst

10459 Hunters Creek Court Jacksonville, Fl. 32256









SPECIAL NOTICE

THIS RESERVE ANALYLSIS INCLUDED A VISUAL OBSERVATION OF MAJOR COMPONENTS FOR YOUR PROPERTY. NO DISTRUCTION TESTING OR OTHER TESTING WAS CONDUCTED TO DETERMINE COMPONENT CONDITION. OUR ANALYSIS INCLUDES COMPONENTS WITH REPLACEMENT COST AND USEFUL LIFE PROJECTIONS THAT ARE TYPICAL FOR THIS TYPE OF FACILITY.

THIS ANALYSIS IS NOT A SAFETY INSPECTION OR STRUCTURAL INSPECTION AND WE RECOMMEND THE ASSOCIATION CONDUCT THOSE INSPECTIONS ON A REGULAR BASIS WITH QUALIFIED CONSULTANTS.

TABLE OF CONTENTS

EXECUTIVE SUMMARY	
Executive Summary	1-1
Financial Summary - Recommended Funding Plan	1-2
Cash Flow Funding Plan Chart	
Current Funding Plan vs Recommended Funding Plan	1-4
CURRENT FUNDING PLAN	
Financial Summary - Current Funding Plan	2-1
Current Funding Plan Projection	2-2
CASH FLOW	
Income & Expense Spreadsheet	3-1
EXPENDITURE DETAIL	
Annual Expenditure Detail	4-1
Asset Current Cost by Category	4-12
COMPONENT INVENTORY	
Component Inventory	5-1
Component Detail Index	5-5
Component Detail	5-9
DISCLOSURERS & INFORMATION	
Report Navigation	6-1
Methodology & Information	6-2
Terms of Service	6-3
Definitions	6-4

Executive Summary

Account Information

Account Name Pine Ridge Plantation CDD Account Number 2022

City Middleburg Last Site Visit March, 4 2024
State Florida Report Date May, 18 2024

In Service Date June, 15 2008 Report Version 4

Total Units 737 Fiscal Year Start October, 1 2024
Study Level Level II Update Fiscal year End September, 30 2025

Reserve Fund Information

Current Component Replacement Cost \$1,667,265

Number of Components 93

Reserve Fund Beginning Balance \$717,350
Billing Term Annually

Component Funding (Straight Line)

Recommended First Year Reserve Fund Contribution \$70,457
Interest Rate on Reserve Deposits 0%
Inflation Rate on Replacement Cost 0%

Pooled Cash (Current Funding Plan)

Current Year Reserve Fund Contribution \$82,202
Interest Rate on Reserve Deposits 3.0%
Inflation Rate on Replacement Cost 3.5%
Annual Contribution Increases 3.0%

Pooled Cash (Recommended Funding Plan)

Recommended First Year Reserve Fund Contribution

Interest Rate on Reserve Deposits

Inflation Rate on Replacement Cost

Annual Contribution Increases

\$83,529

3.0%

3.0%

Comment

- Current funding plan maintains adequate funding.
- Recommended funding plan maintains adequate funding with larger year end balances.
- This analysis should be updated annualy with a site visit every 2 years to monitor component condition and update component replacement cost, interest and inflation rates.
- This revision, V4 changes Furniture, Fixtures & Equipment category to Misc. Components to prevent printing error.

Pine Ridge Plantation CDD Financial Summary - Recommended Funding Plan

Begining Balance: \$717,350 Fully Funded: \$710,533 Tax Rate:0%

	208111		φ, 1, 1,000	1 071	-)	ω. φ. 10,000	2 44.1 2 4			
				ior			× 8	şo		28° . ;
	, seat	igh	\$ 10° 15°		,	\$	ze ^o ziii	, thouse	स्तुर्व स्व	is the right
Year	A SOUND SOUN	talaga de		ogst ricolds	A Signal Signal	4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4		To Spine	25 to 15 2	्कं श्वेषाते
24-25	1,667,265	3.5%	83,529	0	3.00%	23,355	22,380	801,854	798,751	100%
25-26	1,721,707	3.5%	86,035	0	3.00%	26,171	15,525	898,535	899,238	100%
26-27	1,781,967	3.5%	88,616	0	3.00%	25,545	135,660	877,036	882,527	99%
27-28	1,844,336	3.5%	91,275	0	3.00%	27,027	67,410	927,928	939,165	99%
28-29	1,908,887	3.5%	94,013	0	3.00%	30,348	10,328	1,041,961	1,060,209	98%
29-30	1,975,698	3.5%	96,833	0	3.00%	33,102	35,393	1,136,504	1,163,123	98%
30-31	2,044,848	3.5%	99,738	0	3.00%	35,723	45,473	1,226,492	1,262,792	97%
31-32	2,116,417	3.5%	102,730	0	3.00%	39,228	21,629	1,346,822	1,394,339	97%
32-33	2,190,492	3.5%	105,812	0	3.00%	34,738	294,711	1,192,661	1,251,690	95%
33-34	2,209,918	3.5%	108,987	0	3.00%	36,146	96,766	1,241,028	1,308,157	95%
34-35	2,223,788	3.5%	112,256	0	3.00%	31,167	314,383	1,070,069	1,143,310	94%
35-36	2,301,620	3.5%	115,624	0	3.00%	35,177	13,140	1,207,730	1,291,110	94%
36-37	2,382,177	3.5%	119,093	0	3.00%	37,894	63,676	1,301,040	1,396,027	93%
37-38	2,461,956	3.5%	122,665	0	3.00%	33,891	293,992	1,163,605	1,270,104	92%
38-39	2,548,125	3.5%	126,345	0	3.00%	31,189	250,302	1,070,838	1,189,802	90%
39-40	2,637,309	3.5%	130,136	0	3.00%	35,253	25,867	1,210,359	1,343,706	90%
40-41	2,729,615	3.5%	134,040	0	3.00%	39,552	26,010	1,357,941	1,507,717	90%
41-42	2,825,151	3.5%	138,061	0	3.00%	44,318	18,736	1,521,584	1,690,032	90%
42-43	2,924,032	3.5%	142,203	0	3.00%	45,000	163,793	1,544,993	1,733,807	89%
43-44	3,026,373	3.5%	146,469	0	3.00%	48,783	65,365	1,674,880	1,886,383	89%
44-45	3,132,296	3.5%	150,863	0	3.00%	53,898	29,134	1,850,507	2,087,381	89%
45-46	3,241,926	3.5%	155,389	0	3.00%	59,621	18,535	2,046,982	2,312,165	89%
46-47	3,355,393	3.5%	160,051	0	3.00%	58,960	241,696	2,024,296	2,319,826	87%
47-48	3,472,832	3.5%	164,852	0	3.00%	41,401	809,128	1,421,421	1,740,273	82%
48-49	3,594,381	3.5%	169,798	0	3.00%	45,435	76,720	1,559,934	1,911,753	82%
49-50	3,684,736	3.5%	174,892	0	3.00%	49,932	70,425	1,714,333	2,099,576	82%
50-51	3,813,702	3.5%	180,138	0	3.00%	47,541	309,756	1,632,257	2,054,509	79%
51-52	3,947,181	3.5%	185,543	0	3.00%	52,237	76,555	1,793,482	2,256,300	79%
52-53	4,085,333	3.5%	191,109	0	3.00%	34,209	844,293	1,174,507	1,677,864	70%
53-54	4,228,319	3.5%	196,842	0	3.00%	39,025	70,509	1,339,866	1,887,624	71%


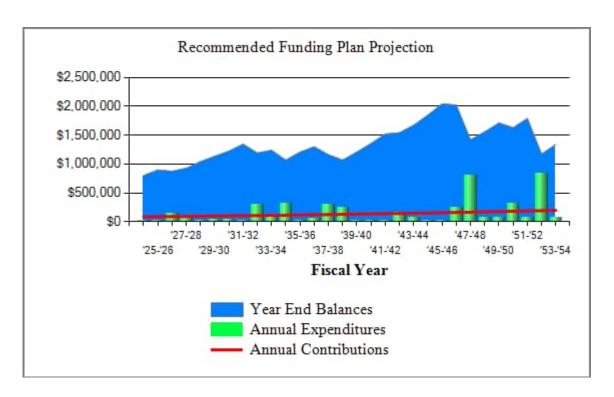


Chart illustrates year end balances and expenditures with the level of contributions necessary to maintain adequate funding.

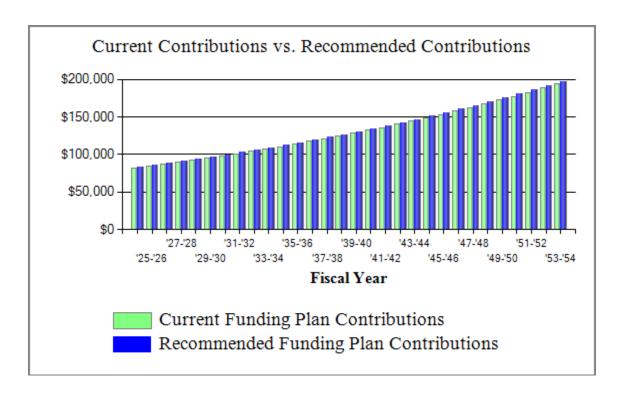


This chart illustrates annual expenditures and compares the current funding plan to the recommended funding plan.

Pine Ridge Plantation CDD Financial Summary - Current Funding Plan

Begining Balance: \$717,350 Fully Funded: \$710,533 Tax Rate:0%

	C	U	,		•					
	nen't			iga			×	ę,	~ .	30° . ;
	Zaen.	aigon .	30 54° 635	gr st		ž,	. Sie State	, End ace	Fro Fr	, Filoris,
Year	Politica se	talaga de	All So Califf	Ogget Acoug	The San	40 Tiling	Zio Cit	Test Blanco	75 to 12 to	to op trade
24-25	1,667,265	3.5%	82,202	0	3.00%	23,315	22,380	800,487	798,751	100%
25-26	1,721,707	3.5%	84,668	0	3.00%	26,089	15,525	895,719	899,238	100%
26-27	1,781,967	3.5%	87,208	0	3.00%	25,418	135,660	872,685	882,527	99%
27-28	1,844,336	3.5%	89,824	0	3.00%	26,853	67,410	921,953	939,165	98%
28-29	1,908,887	3.5%	92,519	0	3.00%	30,124	10,328	1,034,268	1,060,209	98%
29-30	1,975,698	3.5%	95,295	0	3.00%	32,825	35,393	1,126,995	1,163,123	97%
30-31	2,044,848	3.5%	98,153	0	3.00%	35,390	45,473	1,215,066	1,262,792	96%
31-32	2,116,417	3.5%	101,098	0	3.00%	38,836	21,629	1,333,372	1,394,339	96%
32-33	2,190,492	3.5%	104,131	0	3.00%	34,284	294,711	1,177,075	1,251,690	94%
33-34	2,209,918	3.5%	107,255	0	3.00%	35,627	96,766	1,223,191	1,308,157	94%
34-35	2,223,788	3.5%	110,473	0	3.00%	30,578	314,383	1,049,860	1,143,310	92%
35-36	2,301,620	3.5%	113,787	0	3.00%	34,515	13,140	1,185,022	1,291,110	92%
36-37	2,382,177	3.5%	117,200	0	3.00%	37,156	63,676	1,275,702	1,396,027	91%
37-38	2,461,956	3.5%	120,716	0	3.00%	33,073	293,992	1,135,499	1,270,104	89%
38-39	2,548,125	3.5%	124,338	0	3.00%	30,286	250,302	1,039,821	1,189,802	87%
39-40	2,637,309	3.5%	128,068	0	3.00%	34,261	25,867	1,176,282	1,343,706	88%
40-41	2,729,615	3.5%	131,910	0	3.00%	38,465	26,010	1,320,648	1,507,717	88%
41-42	2,825,151	3.5%	135,867	0	3.00%	43,133	18,736	1,480,912	1,690,032	88%
42-43	2,924,032	3.5%	139,943	0	3.00%	43,712	163,793	1,500,774	1,733,807	87%
43-44	3,026,373	3.5%	144,142	0	3.00%	47,387	65,365	1,626,937	1,886,383	86%
44-45	3,132,296	3.5%	148,466	0	3.00%	52,388	29,134	1,798,657	2,087,381	86%
45-46	3,241,926	3.5%	152,920	0	3.00%	57,991	18,535	1,991,033	2,312,165	86%
46-47	3,355,393	3.5%	157,508	0	3.00%	57,205	241,696	1,964,050	2,319,826	85%
47-48	3,472,832	3.5%	162,233	0	3.00%	39,515	809,128	1,356,669	1,740,273	78%
48-49	3,594,381	3.5%	167,100	0	3.00%	43,411	76,720	1,490,461	1,911,753	78%
49-50	3,684,736	3.5%	172,113	0	3.00%	47,764	70,425	1,639,913	2,099,576	78%
50-51	3,813,702	3.5%	177,276	0	3.00%	45,223	309,756	1,552,656	2,054,509	76%
51-52	3,947,181	3.5%	182,594	0	3.00%	49,761	76,555	1,708,457	2,256,300	76%
52-53	4,085,333	3.5%	188,072	0	3.00%	31,567	844,293	1,083,803	1,677,864	65%
53-54	4,228,319	3.5%	193,714	0	3.00%	36,210	70,509	1,243,219	1,887,624	66%

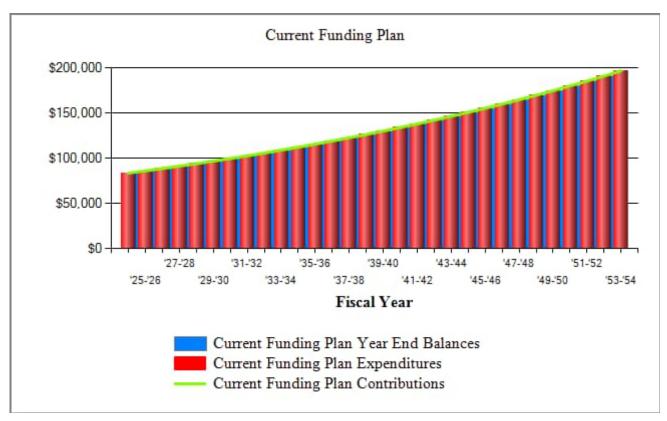

This chart illustrates how the CDD's current funding plan will perform over time.

	24-25	25-26	26-27	27-28	28-29	29-30	30-31	31-32	32-33	33-34
Beginning Balance Annual Assessment	717,350 83,529	801,854 86,035	898,535 88,616	877,036 91,275	927,928 94,013	1,041,961 96,833	1,136,504 99,738	1,226,492 102,730	1,346,822 105,812	1,192,661 108,987
Interest Earned Expenditures Fully Funded Reserves Percent Fully Funded	23,355 22,380 798,751 100%	26,171 15,525 899,238 100%	25,545 135,660 882,527 99%	27,027 67,410 939,165 99%	30,348 10,328 1,060,209 98%	33,102 35,393 1,163,123 98%	35,723 45,473 1,262,792 97%	39,228 21,629 1,394,339 97%	34,738 294,711 1,251,690 95%	36,146 96,766 1,308,157 95%
Ending Balance	801,854	898,535	877,036	927,928			1,226,492			1,241,028
Description Misc. Site Components Monument Sign (Large) Refurbishment Monument Sign (Small) Refurbishment Misc. Site Components Total:		4,140 2,070 6,210								
Fence & Gates Aluminum Fencing - Pool Aluminum Gates/Fence- Entry Chain Link Fence VC - Sport Courts										
Chain Link Fence VC - Sport Courts Chain Link Fence/Gates - Dumpster Viny Ranch Fence - Tynes Blvd. Vinyl Fencing - Pine Ridge Pkwy									3,034 3,455	
Fence & Gates Total:									6,489	
Parking Lots Asphalt Resurfacing - Phase I Asphalt Resurfacing - Phase II									66,367	
Concrete Curbing Allow at Paving - Phase I Concrete Curbing Allow at Paving - Phase II									5,004	
Parking Lots Total:									71,371	
Site Lighting Decorative Light Poles - Parking Lot Decorative Light Poles - Playgound/Trail									22,122 36,871	
Decorative Light Poles - Pool Light Fixtures - Concrete Poles									41,084	
Site Lighting Total:									100,077	

	24-25	25-26	26-27	27-28	28-29	29-30	30-31	31-32	32-33	33-34
Description										
Building Components										
Exterior Door/Window Allowance (Partial Replace)										
Folding Partition - Meeting Room										
Refurbish Allowance - Clubhouse Restrooms										
Refurbish Allowance - Locker Rooms										
Building Components Total:										
Roofing										
Metal Roof - Clubhouse										
Metal Roof - Pool Slide Tower										
Roofing Total:										
Cabinets & Tops										
Cabinets & Top - Outdoor Gathering				3,659						
Cabinets & Tops - Meeting Area									5,899	
Cabinets & Tops - Serving Room									12,220	
Cabinets & Tops Total:				3,659					18,119	
Exterior Painting										
Painting - Clubhouse Siding & Trim										23,169
Painting - Pool Slide Stairs							4,671			
Exterior Painting Total:							4,671			23,169
Flooring										
Carpet - Clubhouse (replace with vinyl)	3,780									
Rubber Floor - Fitness Room									5,804	
Tile Floor - Serving Room									4,365	
Vinyl Plank Floor - Activity Room/Corridor									7,577	
Wood Floor - Family Gathering Room										
Flooring Total:	3,780								17,747	
Misc.Components										
Access Control System				3,881						
Ceiling Fans - Exterior										
Ceiling Fans - Family Gathering Room										

Nisc. Components continued Misc. Components Center Strikess Center Strikess Center Strikess Center Strikess Center Strikess Center Strikess Equip, Allowance (partial replacement) 3,000 3,105 3,214 3,326 3,443 3,563 3,688 3,817 3,950 4,089		24-25	25-26	26-27	27-28	28-29	29-30	30-31	31-32	32-33	33-34
Celing Fans - Fitness Center Fitness Equip. Allowance (partial replacement) 3,000 3,105 3,214 3,326 3,443 3,563 3,688 3,817 3,950 4,089 Fitness Equip. Replace Allowance Furniture Allowance - Clubhouse 14,252 Furniture Allowance (partial replacement	Description										
Fitness Equip, Allowance (partial replacement) 3,000 3,105 3,214 3,326 3,43 3,563 3,688 3,817 3,950 4,089 Fitness Equip, Replace Allowance Fitness Equip, Replace Allowance Furniture Allowance (partial replaceme 3,000 3,105 3,214 3,326 3,443 3,563 3,688 3,817 3,950 4,089 Pool/Patio Furniture Replacement Allowance Fool/Patio Furniture Replacement Allowance Security Camera System System Security Camera System S	Misc.Components continued										
Fitness Equip. Replace Allowance Furniture Allowance Furnitu	Ceiling Fans - Fitness Center										
Puriture Allowance - Clubhouse 14,252 14,252 14,252 14,252 14,252 14,252 14,252 14,252 14,252 14,252 14,252 14,252 14,252 14,252 14,252 14,252 14,252 15,316 14,252 14,252 15,316 14,252 14,252 15,316 14,252 15,3		3,000	3,105	3,214	3,326	3,443	3,563	3,688	3,817	3,950	4,089
Office Furniture											
Pool/Patio Furniture Allowance (partial replacement. 3,000 3,105 3,214 3,326 3,443 3,563 3,688 3,817 3,950 4,089 Pool/Patio Furniture Replacement Allowance 55,306 Recursive Camera System Allowance 50,000 5,210 5,427 10,533 6,885 23,754 7,376 7,634 63,207 8,177 Recursive Camera System Systems 50,000 5,21											
Pool/Patio Furniture Replacement Allowance Security Camera System Allowance Security Camera Came		2,000	2 105	2 21 4	2 226	2.442		2 (00	2 017	2.050	4.000
Nise Components Total: 6,000 6,210 6,427 10,533 6,885 23,754 7,376 7,634 63,207 8,177	• •	3,000	3,105	3,214	3,326	3,443	3,363	3,088	3,817		4,089
Misc.Components Total: 6,000 6,210 6,427 10,533 6,885 23,754 7,376 7,634 63,207 8,177 HVAC Equipment Air Handler (refurbished) HVAC Unit 1 HVAC Unit 2 FIVAC Unit 3 A Condensor HVAC Unit 3 B Condensor HVAC Equipment Total: 9,600 FIVAC Equipment Total: 10,178										33,300	
HVAC Equipment Air Handler (refurbished) HVAC Unit 1 HVAC Unit 2 HVAC Unit 2 HVAC Unit 3 A Condensor 6,000 HVAC Equipment Total: 9,600 HVAC Equipment Total: 10,178 Life Safety Systems Fire Alarm Panel Life Safety Systems Fire Alarm Panel Rigary Systems Fire Alarm Panel Sorte Safety Systems Fire Alarm Panel Life Safety Systems Fire Alarm Panel Sorte Safety Systems Fire Alarm Panel Life Safety Systems Fire Alarm Panel Sorte Safety Systems Fire Alarm Panel Life Safety Systems Fire Alarm Panel Sorte Safety Systems Fire Alarm Panel Life Safety Systems Fire Alarm Panel Sorte Safety Systems Fire Alarm Panel Life Safety Systems Sire Alarm Panel Sorte Safety Systems Sorte Safety S		6.000	6.210	6.427	10.533	6.885	23.754	7.376	7.634	63.207	8.177
Air Handler (refurbished) HVAC Unit 1 HVAC Unit 2 HVAC Unit 3 A Condensor 6,000 HVAC Unit 3 B Condensor 3,600 HVAC Equipment Total: 9,600 Life Safety Systems Fire Alarm Panel 8,076 Life Safety Systems Total: 8,076 Playground Equipment Allowance Wood Benches/Tables Playground Total: 27,718 Sport Courts Prinking Fountain Shade Fabric - Sport Courts Shade Structure Replacement - Sport Courts Sport Court Replacement Sport Court Resurfacing (color coat)	•	3,000	0,220	٠, ٠= ٠	20,000	0,000		.,	7,00	00,207	0,277
HVAC Unit 1 HVAC Unit 2 HVAC Unit 3 A Condensor HVAC Unit 3 B Condensor HVAC Unit 3 B Condensor HVAC Equipment Total: Life Safety Systems Fire Alarm Panel Life Safety Systems Fire Alarm Panel Life Safety Systems Fire Alarm Panel Life Safety Systems Total: Playground Playground Equipment Allowance Playground Equipment Allowance Playground Equipment Allowance Fire Alarm Panel Life Safety Systems Total: Playground Equipment Allowance Playground Equipment Allowance Fire Alarm Panel Life Safety Systems Total: Syort Courts Fire Alarm Panel Life Safety Systems Systems Total: Systems To											
HVAC Unit 2											
HVAC Unit 3 A Condensor 6,000 HVAC Unit 3 B Condensor 3,600 HVAC Equipment Total: 9,600 Life Safety Systems Fire Alarm Panel 8,076 Life Safety Systems Total: 8,076 Life Safety Systems Total: 8,076 Playground Playground Equipment Allowance 27,718 Wood Benches/Tables 6,321 Playground Total: 27,718 Sport Courts Drinking Fountain Shade Fabric - Sport Courts Shade Structure Replacement - Sport Courts Sport Court Replacement Sport Court Replacement Sport Court Resurfacing (color coat) 5,000 10,178 10,178 10,178 10,178 10,178 10,271 10									10 179		
HVAC Unit 3 B Condensor 3,600 10,178		6.000							10,176		
HVAC Equipment Total: Life Safety Systems Fire Alarm Panel Life Safety Systems Total: Playground Playground Equipment Allowance Wood Benches/Tables Playground Total: 27,718 Wood Benches/Tables Playground Total: Sport Courts Drinking Fountain Shade Fabric - Sport Courts Shade Structure Replacement - Sport Courts Sport Court Replacement Sport Court Replacement Sport Court Resurfacing (color coat) 9,600 10,178 10,1											
Fire Alarm Panel Life Safety Systems Total: Playground Playground Equipment Allowance Wood Benches/Tables Playground Total: Sport Courts Drinking Fountain Shade Fabric - Sport Courts Shade Structure Replacement - Sport Courts Sport Court Replacement Sport Court Resurfacing (color coat) Sport Court Resurfacing (color coat)									10,178		
Fire Alarm Panel 8,076 Life Safety Systems Total: 8,076 Playground Playground Equipment Allowance 27,718 Wood Benches/Tables 6,321 Playground Total: 27,718 6,321 Sport Courts Drinking Fountain Shade Fabric - Sport Courts Shade Structure Replacement - Sport Courts Sport Court Replacement Sport Court Replacement Sport Court Resurfacing (color coat) 29,738	Life Safety Systems										
Life Safety Systems Total: Playground Playground Equipment Allowance Playground Equipment Allowance 27,718 Wood Benches/Tables 6,321 Playground Total: 27,718 Sport Courts Drinking Fountain Shade Fabric - Sport Courts Shade Structure Replacement - Sport Courts Sport Court Replacement Sport Court Resurfacing (color coat) 29,738							8.076				
Playground Equipment Allowance 27,718 Wood Benches/Tables 6,321 Playground Total: 27,718 6,321 Sport Courts Drinking Fountain Shade Fabric - Sport Courts Shade Structure Replacement - Sport Courts Sport Court Replacement Sport Court Resurfacing (color coat) 29,738											
Playground Equipment Allowance 27,718 Wood Benches/Tables 6,321 Playground Total: 27,718 Sport Courts Drinking Fountain Shade Fabric - Sport Courts Shade Structure Replacement - Sport Courts Sport Court Replacement Sport Court Resurfacing (color coat) 29,738							,				
Wood Benches/Tables Playground Total: 27,718 6,321 Sport Courts Drinking Fountain Shade Fabric - Sport Courts Shade Structure Replacement - Sport Courts Sport Court Replacement Sport Court Resurfacing (color coat) 29,738					27.710						
Playground Total: Sport Courts Drinking Fountain Shade Fabric - Sport Courts Shade Structure Replacement - Sport Courts Sport Court Replacement Sport Court Resurfacing (color coat) 27,718 6,321 6,321					27,710					6 321	
Sport Courts Drinking Fountain Shade Fabric - Sport Courts Shade Structure Replacement - Sport Courts Sport Court Replacement Sport Court Resurfacing (color coat) 29,738					27.718						
Drinking Fountain Shade Fabric - Sport Courts Shade Structure Replacement - Sport Courts Sport Court Replacement Sport Court Resurfacing (color coat) 29,738					2.,.20					0,022	
Shade Fabric - Sport Courts Shade Structure Replacement - Sport Courts Sport Court Replacement Sport Court Resurfacing (color coat) 29,738											
Shade Structure Replacement - Sport Courts Sport Court Replacement Sport Court Resurfacing (color coat) 29,738											
Sport Court Replacement Sport Court Resurfacing (color coat) 29,738											
Sport Court Resurfacing (color coat) 29,738											
								29.738			
	Sport Courts Total:							29,738			

	24-25	25-26	26-27	27-28	28-29	29-30	30-31	31-32	32-33	33-34
Description				_, _,	_0 _>	_, _,	0001	0_0_	0_ 00	
Swimming Pool										
Concrete Pavers - Pool Deck/Patio										
Fiberglass Refurbish Allow - Pool Slide										
Filtration Equip Allowance (partial replacement)	3,000	3,105	3,214	3,326	3,443	3,563	3,688	3,817	3,950	4,089
Filtration System Refurishment Allowance										
Pool Lift									7,429	
Pool Resurfacing/Tile			126,019							
Pool Splash Equipment Allowance				22,174						
Refurbish Allowance - Pool Slide Frame										
Shade Fabric - Pool										
Shade Structure Replacement										61,330
Splash Pad Equipment Allowance	• • • • •	- 10-	100.000						11.000	
Swimming Pool Total:	3,000	3,105	129,233	25,501	3,443	3,563	3,688	3,817	11,380	65,419
Operating Expense										
Backflow Preventer Repair	Unfunded									
Electrical Panels/Disconnects	Unfunded									
Fire Detection Devices	Unfunded									
Flag Pole	Unfunded									
Grills	Unfunded									
Interior Painting - Clubhouse	Unfunded									
Laminated Beam Repair	Unfunded									
Message Board	Unfunded									
Painting - Entry Features	Unfunded									
Painting - Pool Equipment Yard	Unfunded									
Pendent Lights - Breezeway	Unfunded									
Refrigerator	Unfunded									
Splash Pad Coating/Repair	Unfunded									
Sport Court Nets/Equipment	Unfunded									
Trash Cans/ Misc. Site Furnishings	Unfunded									
Water Coolers - Clubhouse	Unfunded									
Water Heater - Clubhouse	Unfunded									

	24-25	25-26	26-27	27-28	28-29	29-30	30-31	31-32	32-33	33-34
Description										
Not Included										
Backflow Preventer Replacement	Unfunded									
Building Foundation/Frame	Unfunded									
Communication Wiring/Devices in Building	Unfunded									
Electrical Wiring/Devices in Building	Unfunded									
Light Poles (Concrete) - Parking Lot	Unfunded									
Siding/Trim Replacement	Unfunded									
Site Utilities	Unfunded									
Water/Sewer/Vent Piping In building	Unfunded									
Components Removed										
Wood Pergolas - Entry Signs	Unfunded									
Year Total:	22,380	15,525	135,660	67,410	10,328	35,393	45,473	21,629	294,711	96,766

	34-35	35-36	36-37	37-38	38-39	39-40	40-41	41-42	42-43	43-44
Beginning Balance Annual Assessment Interest Earned	1,241,028 112,256 31,167	1,070,069 115,624 35,177	1,207,730 119,093 37,894	1,301,040 122,665 33,891	1,163,605 126,345 31,189	1,070,838 130,136 35,253	1,210,359 134,040 39,552	1,357,941 138,061 44,318	1,521,584 142,203 45,000	1,544,993 146,469 48,783
Expenditures Fully Funded Reserves Percent Fully Funded Ending Balance	314,383 1,143,310 94% 1,070,069	13,140 1,291,110 94% 1,207,730	63,676 1,396,027 93% 1,301,040	293,992 1,270,104 92% 1,163,605	250,302 1,189,802 90%	25,867	26,010 1,507,717 90%	18,736 1,690,032 90%	163,793 1,733,807 89% 1,544,993	65,365 1,886,383 89% 1,674,880
Description Misc. Site Components Monument Sign (Large) Refurbishment Monument Sign (Small) Refurbishment		,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	,,,,,,,,	.,,	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	6,936 3,468	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	,,,,,,,,
Misc. Site Components Total: Fence & Gates Aluminum Fencing - Pool							10,404		7.001	
Aluminum Gates/Fence- Entry Chain Link Fence VC - Sport Courts Chain Link Fence/Gates - Dumpster Viny Ranch Fence - Tynes Blvd.									7,801	
Vinyl Fencing - Pine Ridge Pkwy Fence & Gates Total:									7,801	
Parking Lots Asphalt Resurfacing - Phase I Asphalt Resurfacing - Phase II Concrete Curbing Allow at Paving - Phase I Concrete Curbing Allow at Paving - Phase II Parking Lots Total:										
Site Lighting Decorative Light Poles - Parking Lot										
Decorative Light Poles - Playgound/Trail Decorative Light Poles - Pool Light Fixtures - Concrete Poles Site Lighting Total:									11,888 11,888	

	34-35	35-36	36-37	37-38	38-39	39-40	40-41	41-42	42-43	43-44
Description										
Building Components										
Exterior Door/Window Allowance (Partial Replace	e)									
Folding Partition - Meeting Room				4,473						
Refurbish Allowance - Clubhouse Restrooms	46,945									
Refurbish Allowance - Locker Rooms Building Components Total:	146,973 193,918			4,473						
-	193,918			4,473						
Roofing										
Metal Roof - Clubhouse				270,940						
Metal Roof - Pool Slide Tower				4,504						
Roofing Total:				275,444						
Cabinets & Tops										
Cabinets & Top - Outdoor Gathering										
Cabinets & Tops - Meeting Area										
Cabinets & Tops - Serving Room										
Cabinets & Tops Total:										
Exterior Painting										
Painting - Clubhouse Siding & Trim										32,683
Painting - Pool Slide Stairs					6,151					
Exterior Painting Total:					6,151					32,683
Flooring										
Carpet - Clubhouse (replace with vinyl)										
Rubber Floor - Fitness Room										
Tile Floor - Serving Room										
Vinyl Plank Floor - Activity Room/Corridor										
Wood Floor - Family Gathering Room									18,723	
Flooring Total:									18,723	
Misc.Components										
Access Control System									6,501	
Ceiling Fans - Exterior			9,429							
Ceiling Fans - Family Gathering Room								2,584		

	34-35	35-36	36-37	37-38	38-39	39-40	40-41	41-42	42-43	43-44
Description										
Misc.Components continued										
Ceiling Fans - Fitness Center						2,413				
Fitness Equip. Allowance (partial replacement)	4,232	4,380	4,533	4,692	4,856	5,026	5,202	5,384	5,572	5,768
Fitness Equip. Replace Allowance										
Furniture Allowance - Clubhouse										
Office Furniture										
Pool/Patio Furniture Allowance (partial replaceme	4,232	4,380	4,533	4,692	4,856	5,026	5,202	5,384	5,572	5,768
Pool/Patio Furniture Replacement Allowance			22.666							
Security Camera System Allowance	0.464	0.7(0	22,666	0.204	0.712	10.465	10.404	12.252	17 (4)	11 525
Misc.Components Total:	8,464	8,760	41,162	9,384	9,712	12,465	10,404	13,352	17,646	11,535
HVAC Equipment										
Air Handler (refurbished)						8,377				
HVAC Unit 1	11,849									
HVAC Unit 2										15,380
HVAC Unit 3 A Condensor			9,066							
HVAC Unit 3 B Condensor			5,440							
HVAC Equipment Total:	11,849		14,506			8,377				15,380
Life Safety Systems										
Fire Alarm Panel										
Life Safety Systems Total:										
Playground										
Playground Equipment Allowance									46,437	
Wood Benches/Tables									,	
Playground Total:									46,437	
Sport Courts										
Drinking Fountain										
Shade Fabric - Sport Courts			3,475							
Shade Structure Replacement - Sport Courts										
Sport Court Replacement										
Sport Court Resurfacing (color coat)					39,159					
Sport Courts Total:			3,475		39,159					

Community Advisors Page 3-8 May 18, 2024

	34-35	35-36	36-37	37-38	38-39	39-40	40-41	41-42	42-43	43-44
Description	34-33	33-30	30-37	37-30	30-37	37-40	40-41	71-72	42-43	43-44
Swimming Pool										
Concrete Pavers - Pool Deck/Patio										
Fiberglass Refurbish Allow - Pool Slide	40,907									
Filtration Equip Allowance (partial replacement)	4,232	4,380	4,533	4,692	4,856	5,026	5,202	5,384	5,572	5,768
Filtration System Refurishment Allowance	4,232	4,360	4,333	4,092	4,630	3,020	3,202	3,364	55,725	3,708
Pool Lift									33,723	
Pool Resurfacing/Tile					190,423					
Pool Splash Equipment Allowance					190,423					
Refurbish Allowance - Pool Slide Frame	55,013									
Shade Fabric - Pool	33,013									
Shade Structure Replacement										
Splash Pad Equipment Allowance										
Swimming Pool Total:	100,153	4,380	4,533	4,692	195,279	5,026	5,202	5,384	61,297	5,768
Swimming I our Iouai.	100,133	4,500	7,555	7,072	173,277	3,020	3,202	3,304	01,277	3,700
Operating Expense										
Backflow Preventer Repair	Unfunded									
Electrical Panels/Disconnects	Unfunded									
Fire Detection Devices	Unfunded									
Flag Pole	Unfunded									
Grills	Unfunded									
Interior Painting - Clubhouse	Unfunded									
Laminated Beam Repair	Unfunded									
Message Board	Unfunded									
Painting - Entry Features	Unfunded									
Painting - Pool Equipment Yard	Unfunded									
Pendent Lights - Breezeway	Unfunded									
Refrigerator	Unfunded									
Splash Pad Coating/Repair	Unfunded									
Sport Court Nets/Equipment	Unfunded									
Trash Cans/ Misc. Site Furnishings	Unfunded									
Water Coolers - Clubhouse	Unfunded									
Water Heater - Clubhouse	Unfunded									

	34-35	35-36	36-37	37-38	38-39	39-40	40-41	41-42	42-43	43-44
Description										
Not Included										
Backflow Preventer Replacement	Unfunded									
Building Foundation/Frame	Unfunded									
Communication Wiring/Devices in Building	Unfunded									
Electrical Wiring/Devices in Building	Unfunded									
Light Poles (Concrete) - Parking Lot	Unfunded									
Siding/Trim Replacement	Unfunded									
Site Utilities	Unfunded									
Water/Sewer/Vent Piping In building	Unfunded									
Components Removed										
Wood Pergolas - Entry Signs	Unfunded									
Year Total:	314,383	13,140	63,676	293,992	250,302	25,867	26,010	18,736	163,793	65,365

	44-45	45-46	46-47	47-48	48-49	49-50	50-51	51-52	52-53	53-54
Beginning Balance Annual Assessment Interest Earned	1,674,880 150,863 53,898	1,850,507 155,389 59,621	2,046,982 160,051 58,960	2,024,296 164,852 41,401	1,421,421 169,798 45,435	1,559,934 174,892 49,932	1,714,333 180,138 47,541	1,632,257 185,543 52,237	1,793,482 191,109 34,209	1,174,507 196,842 39,025
Expenditures Fully Funded Reserves Percent Fully Funded Ending Balance	29,134 2,087,381 89% 1,850,507	18,535 2,312,165 89% 2,046,982	241,696	809,128 1,740,273 82% 1,421,421	76,720 1,911,753 82%	70,425 2,099,576 82%	309,756	76,555 2,256,300 79%	844,293 1,677,864 70% 1,174,507	70,509 1,887,624 71% 1,339,866
Description Misc. Site Components Monument Sign (Large) Refurbishment Monument Sign (Small) Refurbishment Misc. Site Components Total:	_									
Fence & Gates Aluminum Fencing - Pool Aluminum Gates/Fence- Entry				164,956						
Chain Link Fence VC - Sport Courts Chain Link Fence/Gates - Dumpster Viny Ranch Fence - Tynes Blvd. Vinyl Fencing - Pine Ridge Pkwy				28,168					185,634	
Fence & Gates Total:				193,123					185,634	
Parking Lots Asphalt Resurfacing - Phase I Asphalt Resurfacing - Phase II Concrete Curbing Allow at Paving - Phase I				102,571						
Concrete Curbing Allow at Paving - Phase II Parking Lots Total:				8,383 110,954						
Site Lighting Decorative Light Poles - Parking Lot Decorative Light Poles - Playgound/Trail Decorative Light Poles - Pool Light Fixtures - Concrete Poles Site Lighting Total:										

	44-45	45-46	46-47	47-48	48-49	49-50	50-51	51-52	52-53	53-54
Description										
Building Components										
Exterior Door/Window Allowance (Partial Replace)									104,807	
Folding Partition - Meeting Room										
Refurbish Allowance - Clubhouse Restrooms										
Refurbish Allowance - Locker Rooms									10100=	
Building Components Total:									104,807	
Roofing										
Metal Roof - Clubhouse										
Metal Roof - Pool Slide Tower										
Roofing Total:										
Cabinets & Tops										
Cabinets & Top - Outdoor Gathering				7,280						
Cabinets & Tops - Meeting Area										
Cabinets & Tops - Serving Room										
Cabinets & Tops Total:				7,280						
Exterior Painting										
Painting - Clubhouse Siding & Trim										46,102
Painting - Pool Slide Stairs			8,100							
Exterior Painting Total:			8,100							46,102
Flooring										
Carpet - Clubhouse (replace with vinyl)										
Rubber Floor - Fitness Room										
Tile Floor - Serving Room										
Vinyl Plank Floor - Activity Room/Corridor										
Wood Floor - Family Gathering Room										
Flooring Total:										
Misc.Components										
Access Control System										
Ceiling Fans - Exterior								15,797		
Ceiling Fans - Family Gathering Room										

	44-45	45-46	46-47	47-48	48-49	49-50	50-51	51-52	52-53	53-54
Description										
Misc.Components continued										
Ceiling Fans - Fitness Center										
Fitness Equip. Allowance (partial replacement)	5,969	6,178	6,395		6,850	7,090	7,338	7,595	7,861	8,136
Fitness Equip. Replace Allowance				88,245						
Furniture Allowance - Clubhouse						28,359				
Office Furniture	5.060	<i>6</i> 170	6 205	6 610	6 950	4,726	7 220	7.505	7 061	8,136
Pool/Patio Furniture Allowance (partial replaceme Pool/Patio Furniture Replacement Allowance	5,969	6,178	6,395	6,618	6,850	7,090	7,338	7,595	7,861	8,130
Security Camera System Allowance								37,974		
Misc.Components Total:	11,939	12,357	12,789	94,863	13,700	47,265	14,676	68,960	15,721	16,271
HVAC Equipment										
Air Handler (refurbished)										
HVAC Unit 1			17,905							
HVAC Unit 2										
HVAC Unit 3 A Condensor					13,700					
HVAC Unit 3 B Condensor			4=00=		8,220					
HVAC Equipment Total:			17,905		21,920					
Life Safety Systems										
Fire Alarm Panel						16,070				
Life Safety Systems Total:						16,070				
Playground										
Playground Equipment Allowance										
Wood Benches/Tables									12,577	
Playground Total:									12,577	
Sport Courts										
Drinking Fountain									12,577	
Shade Fabric - Sport Courts										
Shade Structure Replacement - Sport Courts					34,250				505 115	
Sport Court Replacement			E1 566						505,117	
Sport Courte Tetals			51,566		24.250				E15 (04	
Sport Courts Total:			51,566		34,250				517,694	

	44.45	45 46	4 < 4	45.40	40.40	40.50	50.51	51 50	50.5 0	50.54
Description	44-45	45-46	46-47	47-48	48-49	49-50	50-51	51-52	52-53	53-54
Description										
Swimming Pool										
Concrete Pavers - Pool Deck/Patio				244,287						
Fiberglass Refurbish Allow - Pool Slide			61,814							
Filtration Equip Allowance (partial replacement)	5,969	6,178	6,395	6,618	6,850	7,090	7,338	7,595	7,861	8,136
Filtration System Refurishment Allowance										
Pool Lift	11,226									
Pool Resurfacing/Tile							287,743			
Pool Splash Equipment Allowance				44,122						
Refurbish Allowance - Pool Slide Frame			83,129							
Shade Fabric - Pool				15,222						
Shade Structure Replacement										
Splash Pad Equipment Allowance				92,657						
Swimming Pool Total:	17,196	6,178	151,337	402,907	6,850	7,090	295,080	7,595	7,861	8,136
Operating Expense										
Backflow Preventer Repair	Unfunded									
Electrical Panels/Disconnects	Unfunded									
Fire Detection Devices	Unfunded									
Flag Pole	Unfunded									
Grills	Unfunded									
Interior Painting - Clubhouse	Unfunded									
Laminated Beam Repair	Unfunded									
Message Board	Unfunded									
Painting - Entry Features	Unfunded									
Painting - Pool Equipment Yard	Unfunded									
Pendent Lights - Breezeway	Unfunded									
Refrigerator	Unfunded									
Splash Pad Coating/Repair	Unfunded									
Sport Court Nets/Equipment	Unfunded									
Trash Cans/ Misc. Site Furnishings	Unfunded									
Water Coolers - Clubhouse	Unfunded									
Water Heater - Clubhouse	Unfunded									

	44-45	45-46	46-47	47-48	48-49	49-50	50-51	51-52	52-53	53-54
Description										
Not Included										
Backflow Preventer Replacement	Unfunded									
Building Foundation/Frame	Unfunded									
Communication Wiring/Devices in Building	Unfunded									
Electrical Wiring/Devices in Building	Unfunded									
Light Poles (Concrete) - Parking Lot	Unfunded									
Siding/Trim Replacement	Unfunded									
Site Utilities	Unfunded									
Water/Sewer/Vent Piping In building	Unfunded									
Components Removed										
Wood Pergolas - Entry Signs	Unfunded									
Year Total:	29,134	18,535	241,696	809,128	76,720	70,425	309,756	76,555	844,293	70,509

Description	Expenditures
Replacement Year 24-25	
Flooring	
Carpet - Clubhouse (replace with vinyl)	3,780
Misc.Components	
Fitness Equip. Allowance (partial replacement)	3,000
Pool/Patio Furniture Allowance (partial replacement)	3,000
HVAC Equipment	
HVAC Unit 3 A Condensor	6,000
HVAC Unit 3 B Condensor	3,600
Swimming Pool	
Filtration Equip Allowance (partial replacement)	3,000
Total for 2024 - 2025	\$22,380
	, ,
Replacement Year 25-26	
Misc. Site Components	
Monument Sign (Large) Refurbishment	4,140
Monument Sign (Small) Refurbishment	2,070
Misc.Components	
Fitness Equip. Allowance (partial replacement)	3,105
Pool/Patio Furniture Allowance (partial replacement)	3,105
Swimming Pool	
Filtration Equip Allowance (partial replacement)	3,105
Total for 2025 - 2026	\$15,525
	. ,
Replacement Year 26-27	
Misc.Components	
Fitness Equip. Allowance (partial replacement)	3,214
Pool/Patio Furniture Allowance (partial replacement)	3,214
Swimming Pool	
Filtration Equip Allowance (partial replacement)	3,214
Pool Resurfacing/Tile	126,019
Total for 2026 - 2027	\$135,660
Donlagement Veer 27.28	
Replacement Year 27-28	
Cabinets & Tops Cabinets & Top Outdoor Cathering	2 (50
Cabinets & Top - Outdoor Gathering	3,659

Description	Expenditures
Replacement Year 27-28 continued	
Misc.Components	
Access Control System	3,881
Fitness Equip. Allowance (partial replacement)	3,326
Pool/Patio Furniture Allowance (partial replacement)	3,326
Playground	
Playground Equipment Allowance	27,718
Swimming Pool	
Filtration Equip Allowance (partial replacement)	3,326
Pool Splash Equipment Allowance	22,174
Total for 2027 - 2028	\$67,410
Replacement Year 28-29	
Misc.Components	
Fitness Equip. Allowance (partial replacement)	3,443
Pool/Patio Furniture Allowance (partial replacement)	3,443
Swimming Pool	
Filtration Equip Allowance (partial replacement)	3,443
Total for 2028 - 2029	\$10,328
Replacement Year 29-30	
Misc.Components	
Fitness Equip. Allowance (partial replacement)	3,563
Furniture Allowance - Clubhouse	14,252
Office Furniture	2,375
Pool/Patio Furniture Allowance (partial replacement)	3,563
Life Safety Systems	
Fire Alarm Panel	8,076
Swimming Pool	,
Filtration Equip Allowance (partial replacement)	3,563
Total for 2029 - 2030	\$35,393
10tai 101 2027 - 2030	φ33,373
Replacement Year 30-31	
Exterior Painting	
Painting - Pool Slide Stairs	4,671

Description	Expenditures
Replacement Year 30-31 continued	
Misc.Components	
Fitness Equip. Allowance (partial replacement)	3,688
Pool/Patio Furniture Allowance (partial replacement)	3,688
Sport Courts	
Sport Court Resurfacing (color coat)	29,738
Swimming Pool	
Filtration Equip Allowance (partial replacement)	3,688
Total for 2030 - 2031	\$45,473
Replacement Year 31-32	
Misc.Components	
Fitness Equip. Allowance (partial replacement)	3,817
Pool/Patio Furniture Allowance (partial replacement)	3,817
HVAC Equipment	
HVAC Unit 2	10,178
Swimming Pool	
Filtration Equip Allowance (partial replacement)	3,817
Total for 2031 - 2032	\$21,629
Replacement Year 32-33	
Fence & Gates	
Chain Link Fence/Gates - Dumpster	3,034
Vinyl Fencing - Pine Ridge Pkwy	3,455
Parking Lots	
Asphalt Resurfacing - Phase I	66,367
Concrete Curbing Allow at Paving - Phase I	5,004
Site Lighting	
Decorative Light Poles - Parking Lot	22,122
Decorative Light Poles - Playgound/Trail	36,871
Decorative Light Poles - Pool	41,084
Cabinets & Tops	5 000
Cabinets & Tops - Meeting Area	5,899
Cabinets & Tops - Serving Room	12,220

Description	Expenditures
Replacement Year 32-33 continued	
Flooring	
Rubber Floor - Fitness Room	5,804
Tile Floor - Serving Room	4,365
Vinyl Plank Floor - Activity Room/Corridor	7,577
Misc.Components	
Fitness Equip. Allowance (partial replacement)	3,950
Pool/Patio Furniture Allowance (partial replacement)	3,950
Pool/Patio Furniture Replacement Allowance	55,306
Playground	
Wood Benches/Tables	6,321
Swimming Pool	
Filtration Equip Allowance (partial replacement)	3,950
Pool Lift	7,429
Total for 2032 - 2033	\$294,711
Replacement Year 33-34	
Exterior Painting	
Painting - Clubhouse Siding & Trim	23,169
Misc.Components	
Fitness Equip. Allowance (partial replacement)	4,089
Pool/Patio Furniture Allowance (partial replacement)	4,089
Swimming Pool	
Filtration Equip Allowance (partial replacement)	4,089
Shade Structure Replacement	61,330
Total for 2033 - 2034	\$96,766
Replacement Year 34-35	
Building Components	
Refurbish Allowance - Clubhouse Restrooms	46,945
Refurbish Allowance - Locker Rooms	146,973
Misc.Components	
Fitness Equip. Allowance (partial replacement)	4,232
Pool/Patio Furniture Allowance (partial replacement)	4,232

Description	Expenditures
Replacement Year 34-35 continued	
HVAC Equipment	
HVAC Unit 1	11,849
Swimming Pool	
Fiberglass Refurbish Allow - Pool Slide	40,907
Filtration Equip Allowance (partial replacement)	4,232
Refurbish Allowance - Pool Slide Frame	55,013
Total for 2034 - 2035	\$314,383
Replacement Year 35-36	
Misc.Components	
Fitness Equip. Allowance (partial replacement)	4,380
Pool/Patio Furniture Allowance (partial replacement)	4,380
Swimming Pool	
Filtration Equip Allowance (partial replacement)	4,380
Total for 2035 - 2036	\$13,140
Replacement Year 36-37	
Misc.Components	
Ceiling Fans - Exterior	9,429
Fitness Equip. Allowance (partial replacement)	4,533
Pool/Patio Furniture Allowance (partial replacement)	4,533
Security Camera System Allowance	22,666
HVAC Equipment	
HVAC Unit 3 A Condensor	9,066
HVAC Unit 3 B Condensor	5,440
Sport Courts	
Shade Fabric - Sport Courts	3,475
Swimming Pool	
Filtration Equip Allowance (partial replacement)	4,533
Total for 2036 - 2037	\$63,676
Replacement Year 37-38	
Building Components	
Folding Partition - Meeting Room	4,473

Description	penditures
Replacement Year 37-38 continued	
Roofing	
Metal Roof - Clubhouse	270,940
Metal Roof - Pool Slide Tower	4,504
Misc.Components	
Fitness Equip. Allowance (partial replacement)	4,692
Pool/Patio Furniture Allowance (partial replacement)	4,692
Swimming Pool	
Filtration Equip Allowance (partial replacement)	4,692
Total for 2037 - 2038	\$293,992
Replacement Year 38-39	
Exterior Painting	
Painting - Pool Slide Stairs	6,151
Misc.Components	
Fitness Equip. Allowance (partial replacement)	4,856
Pool/Patio Furniture Allowance (partial replacement)	4,856
Sport Courts	
Sport Court Resurfacing (color coat)	39,159
Swimming Pool	
Filtration Equip Allowance (partial replacement)	4,856
Pool Resurfacing/Tile	190,423
Total for 2038 - 2039	\$250,302
Replacement Year 39-40	
Misc.Components	
Ceiling Fans - Fitness Center	2,413
Fitness Equip. Allowance (partial replacement)	5,026
Pool/Patio Furniture Allowance (partial replacement)	5,026
HVAC Equipment	
Air Handler (refurbished)	8,377
Swimming Pool	
Filtration Equip Allowance (partial replacement)	5,026
Total for 2039 - 2040	\$25,867


Replacement Year 40-41 Misc. Site Components Monument Sign (Large) Refurbishment 6,936 Monument Sign (Small) Refurbishment 3,468 Misc. Components Fitness Equip. Allowance (partial replacement) 5,202 Pool/Patio Furniture Allowance (partial replacement) 5,202 Swimming Pool Filtration Equip Allowance (partial replacement) 5,202 Replacement Year 41-42 Misc. Components 2,584 Ceiling Fans - Family Gathering Room 2,584 Fincess Equip. Allowance (partial replacement) 5,384 Swimming Pool 5 Filtration Equip Allowance (partial replacement) 5,384 Total for 2041 - 2042 \$18,736 Replacement Year 42-43 *** Fence & Gates Aluminum Gates/Fence- Entry 7,801 Site Lighting Light Fixtures - Concrete Poles 11,888 Flooring *** Wood Floor - Family Gathering Room 18,723 Misc.Components 6,501 Access Control System 6,501	Description	Expenditures
Monument Sign (Large) Refurbishment 3,468 Misc.Components 5,202 Fitness Equip. Allowance (partial replacement) 5,202 Pool/Patio Furniture Allowance (partial replacement) 5,202 Swimming Pool 5,202 Filtration Equip Allowance (partial replacement) 5,202 Total for 2040 - 2041 \$26,010 Replacement Year 41-42 Misc.Components 2,584 Celling Fans - Family Gathering Room 2,584 Fitness Equip. Allowance (partial replacement) 5,384 Pool/Patio Furniture Allowance (partial replacement) 5,384 Swimming Pool 5,384 Filtration Equip Allowance (partial replacement) 5,384 Total for 2041 - 2042 \$18,736 Replacement Year 42-43 Fence & Gates Aluminum Gates/Fence- Entry 7,801 Site Lighting 11,888 Light Fixtures - Concrete Poles 11,888 Flooring 2 Wood Floor - Family Gathering Room 18,723 Misc.Components 5,572 Access Control System	Replacement Year 40-41	
Monument Sign (Large) Refurbishment 3,468 Misc.Components 5,202 Fitness Equip. Allowance (partial replacement) 5,202 Pool/Patio Furniture Allowance (partial replacement) 5,202 Swimming Pool 5,202 Filtration Equip Allowance (partial replacement) 5,202 Total for 2040 - 2041 \$26,010 Replacement Year 41-42 Misc.Components 2,584 Celling Fans - Family Gathering Room 2,584 Fitness Equip. Allowance (partial replacement) 5,384 Pool/Patio Furniture Allowance (partial replacement) 5,384 Swimming Pool 5,384 Filtration Equip Allowance (partial replacement) 5,384 Total for 2041 - 2042 \$18,736 Replacement Year 42-43 Fence & Gates Aluminum Gates/Fence- Entry 7,801 Site Lighting 11,888 Light Fixtures - Concrete Poles 11,888 Flooring 2 Wood Floor - Family Gathering Room 18,723 Misc.Components 5,572 Access Control System	Misc. Site Components	
Misc.Components 5,202 Fitness Equip. Allowance (partial replacement) 5,202 Pool/Patic Furniture Allowance (partial replacement) 5,202 Swimming Pool *26,010 Total for 2040 - 2041 \$26,010 Replacement Year 41-42 *** Misc.Components 2,584 Ceiling Fans - Family Gathering Room 2,584 Fitness Equip. Allowance (partial replacement) 5,384 Pool/Patio Furniture Allowance (partial replacement) 5,384 Swimming Pool *** Filtration Equip Allowance (partial replacement) 5,384 Total for 2041 - 2042 \$18,736 Replacement Year 42-43 *** Fence & Gates *** Aluminum Gates/Fence- Entry 7,801 Site Lighting ** Light Fixtures - Concrete Poles 11,888 Flooring ** Wood Floor - Family Gathering Room 18,723 Misc.Components ** Access Control System 6,501 Fitness Equip. Allowance (partial replacement) 5,572 Pool/Patio Furniture A		6,936
Fitness Equip. Allowance (partial replacement) 5,202 Pool/Patio Furniture Allowance (partial replacement) 5,202 Swimming Pool Filtration Equip Allowance (partial replacement) 5,202 Total for 2040 - 2041 \$26,010 Replacement Year 41-42 *** Misc.Components 2,584 Fitness Equip. Allowance (partial replacement) 5,384 Fitness Equip. Allowance (partial replacement) 5,384 Pool/Patio Furniture Allowance (partial replacement) 5,384 Total for 2041 - 2042 \$18,736 Replacement Year 42-43 *** Fence & Gates Aluminum Gates/Fence- Entry 7,801 Site Lighting Light Fixtures - Concrete Poles 11,888 Flooring Wood Floor - Family Gathering Room 18,723 Misc.Components Access Control System Access Control System Fitness Equip. Allowance (partial replacement) Fitness Equip. Allowanc	Monument Sign (Small) Refurbishment	3,468
Fitness Equip. Allowance (partial replacement) 5,202 Pool/Patio Furniture Allowance (partial replacement) 5,202 Swimming Pool Filtration Equip Allowance (partial replacement) 5,202 Total for 2040 - 2041 \$26,010 Replacement Year 41-42 *** Misc.Components 2,584 Fitness Equip. Allowance (partial replacement) 5,384 Fitness Equip. Allowance (partial replacement) 5,384 Pool/Patio Furniture Allowance (partial replacement) 5,384 Total for 2041 - 2042 \$18,736 Replacement Year 42-43 *** Fence & Gates Aluminum Gates/Fence- Entry 7,801 Site Lighting Light Fixtures - Concrete Poles 11,888 Flooring Wood Floor - Family Gathering Room 18,723 Misc.Components Access Control System Access Control System Fitness Equip. Allowance (partial replacement) Fitness Equip. Allowanc	Misc.Components	
Pool/Patio Furniture Allowance (partial replacement) 5,202 Swimming Pool Filtration Equip Allowance (partial replacement) 5,202 Total for 2040 - 2041 \$26,010 Replacement Year 41-42 Misc.Components Ceiling Fans - Family Gathering Room 2,584 Fitness Equip. Allowance (partial replacement) 5,384 Pool/Patio Furniture Allowance (partial replacement) 5,384 Swimming Pool Filtration Equip Allowance (partial replacement) 5,384 Total for 2041 - 2042 \$18,736 Replacement Year 42-43 Fence & Gates Aluminum Gates/Fence- Entry 7,801 Site Lighting Light Fixtures - Concrete Poles 11,888 Flooring Wood Floor - Family Gathering Room 18,723 Misc.Components Access Control System Access Control System Fitness Equip. Allowance (partial replacement) 6,501 Fitness Equip. Allowance (partial replacement) 5,572 Pool/Patio Furniture Allowance (partial replacement) 5,572 Playground Equipment Allowance 46,437 Swimming Pool	•	5,202
Filtration Equip Allowance (partial replacement) 5,202 Total for 2040 - 2041 \$26,010 Replacement Year 41-42 **** Misc.Components** 		5,202
Total for 2040 - 2041 \$26,010 Replacement Year 41-42 *** Misc. Components *** Ceiling Fans - Family Gathering Room 2,584 Fitness Equip. Allowance (partial replacement) 5,384 Pool/Patio Furniture Allowance (partial replacement) 5,384 Swimming Pool *** Filtration Equip Allowance (partial replacement) 5,384 Total for 2041 - 2042 \$18,736 Replacement Year 42-43 *** Fence & Gates *** Aluminum Gates/Fence- Entry 7,801 Site Lighting *** Light Fixtures - Concrete Poles 11,888 Flooring *** Wood Floor - Family Gathering Room 18,723 Misc. Components *** Access Control System 6,501 Fitness Equip. Allowance (partial replacement) 5,572 Pool/Patio Furniture Allowance (partial replacement) 5,572 Playground *** Playground Equipment Allowance 46,437	Swimming Pool	
Replacement Year 41-42 Misc. Components 2,584 Ceiling Fans - Family Gathering Room 2,584 Fitness Equip. Allowance (partial replacement) 5,384 Pool/Patio Furniture Allowance (partial replacement) 5,384 Swimming Pool 5,384 Filtration Equip Allowance (partial replacement) 5,384 Total for 2041 - 2042 \$18,736 Replacement Year 42-43 *** Fence & Gates 3 Aluminum Gates/Fence- Entry 7,801 Site Lighting *** Light Fixtures - Concrete Poles 11,888 Flooring *** Wood Floor - Family Gathering Room 18,723 Misc. Components *** Access Control System 6,501 Fitness Equip. Allowance (partial replacement) 5,572 Pool/Patio Furniture Allowance (partial replacement) 5,572 Playground *** Playground Equipment Allowance 46,437 Swimming Pool	Filtration Equip Allowance (partial replacement)	5,202
Misc. Components 2,584 Ceiling Fans - Family Gathering Room 2,584 Fitness Equip. Allowance (partial replacement) 5,384 Pool/Patio Furniture Allowance (partial replacement) 5,384 Swimming Pool 5,384 Filtration Equip Allowance (partial replacement) 5,384 Total for 2041 - 2042 \$18,736 Replacement Year 42-43 7,801 Fence & Gates 7,801 Aluminum Gates/Fence- Entry 7,801 Site Lighting 11,888 Light Fixtures - Concrete Poles 11,888 Flooring 18,723 Wood Floor - Family Gathering Room 18,723 Misc. Components 6,501 Access Control System 6,501 Fitness Equip. Allowance (partial replacement) 5,572 Pool/Patio Furniture Allowance (partial replacement) 5,572 Playground 46,437 Swimming Pool 46,437	Total for 2040 - 2041	\$26,010
Misc. Components 2,584 Ceiling Fans - Family Gathering Room 2,584 Fitness Equip. Allowance (partial replacement) 5,384 Pool/Patio Furniture Allowance (partial replacement) 5,384 Swimming Pool 5,384 Filtration Equip Allowance (partial replacement) 5,384 Total for 2041 - 2042 \$18,736 Replacement Year 42-43 7,801 Fence & Gates 7,801 Aluminum Gates/Fence- Entry 7,801 Site Lighting 11,888 Light Fixtures - Concrete Poles 11,888 Flooring 18,723 Wood Floor - Family Gathering Room 18,723 Misc. Components 6,501 Access Control System 6,501 Fitness Equip. Allowance (partial replacement) 5,572 Pool/Patio Furniture Allowance (partial replacement) 5,572 Playground 46,437 Swimming Pool 46,437	Replacement Year 41-42	
Ceiling Fans - Family Gathering Room 2,584 Fitness Equip. Allowance (partial replacement) 5,384 Pool/Patio Furniture Allowance (partial replacement) 5,384 Swimming Pool 5,384 Filtration Equip Allowance (partial replacement) 5,384 Total for 2041 - 2042 \$18,736 Replacement Year 42-43 *** Fence & Gates Aluminum Gates/Fence- Entry 7,801 Site Lighting 11,888 Light Fixtures - Concrete Poles 11,888 Flooring 18,723 Wood Floor - Family Gathering Room 18,723 Misc. Components 6,501 Access Control System 6,501 Fitness Equip. Allowance (partial replacement) 5,572 Pool/Patio Furniture Allowance (partial replacement) 5,572 Playground 46,437 Swimming Pool 46,437	•	
Fitness Equip. Allowance (partial replacement) 5,384 Pool/Patio Furniture Allowance (partial replacement) 5,384 Swimming Pool 	•	2.584
Pool/Patio Furniture Allowance (partial replacement) 5,384 Swimming Pool	• •	· ·
Filtration Equip Allowance (partial replacement) Filtration Equip Allowance (partial replacement) Total for 2041 - 2042 Replacement Year 42-43 Fence & Gates Aluminum Gates/Fence- Entry Site Lighting Light Fixtures - Concrete Poles Flooring Wood Floor - Family Gathering Room Misc.Components Access Control System Access Control System Fitness Equip. Allowance (partial replacement) Pool/Patio Furniture Allowance (partial replacement) Playground Playground Equipment Allowance Swimming Pool		
Filtration Equip Allowance (partial replacement) 5,384 Total for 2041 - 2042 \$18,736 Replacement Year 42-43 *** Fence & Gates *** Aluminum Gates/Fence- Entry 7,801 Site Lighting *** Light Fixtures - Concrete Poles 11,888 Flooring *** Wood Floor - Family Gathering Room 18,723 Misc.Components *** Access Control System 6,501 Fitness Equip. Allowance (partial replacement) 5,572 Pool/Patio Furniture Allowance (partial replacement) 5,572 Playground *** Playground Equipment Allowance 46,437 Swimming Pool		3,301
Total for 2041 - 2042 \$18,736 Replacement Year 42-43 Fence & Gates Aluminum Gates/Fence- Entry 7,801 Site Lighting Light Fixtures - Concrete Poles 11,888 Flooring Wood Floor - Family Gathering Room 18,723 Misc.Components Access Control System 6,501 Fitness Equip. Allowance (partial replacement) 5,572 Pool/Patio Furniture Allowance (partial replacement) 5,572 Playground Playground Equipment Allowance 46,437 Swimming Pool	8	5.384
Replacement Year 42-43 Fence & Gates Aluminum Gates/Fence- Entry 7,801 Site Lighting Light Fixtures - Concrete Poles 11,888 Flooring Wood Floor - Family Gathering Room 18,723 Misc.Components Access Control System 6,501 Fitness Equip. Allowance (partial replacement) 5,572 Pool/Patio Furniture Allowance (partial replacement) 5,572 Playground Playground Equipment Allowance (346,437 Swimming Pool		- <u> </u>
Fence & Gates Aluminum Gates/Fence- Entry 7,801 Site Lighting Light Fixtures - Concrete Poles 11,888 Flooring Wood Floor - Family Gathering Room 18,723 Misc.Components Access Control System Access Control System Fitness Equip. Allowance (partial replacement) Pool/Patio Furniture Allowance (partial replacement) Playground Playground Playground Equipment Allowance Playground Equipment Allowance Swimming Pool	10tal 101 2041 - 2042	\$10,730
Aluminum Gates/Fence- Entry Site Lighting Light Fixtures - Concrete Poles Flooring Wood Floor - Family Gathering Room Misc.Components Access Control System Access Control System Fitness Equip. Allowance (partial replacement) Pool/Patio Furniture Allowance (partial replacement) Playground Playground Equipment Allowance Swimming Pool 7,801 7,801 6,501 18,723	Replacement Year 42-43	
Site Lighting Light Fixtures - Concrete Poles 11,888 Flooring Wood Floor - Family Gathering Room 18,723 Misc.Components Access Control System 6,501 Fitness Equip. Allowance (partial replacement) 5,572 Pool/Patio Furniture Allowance (partial replacement) 5,572 Playground Playground Equipment Allowance 46,437 Swimming Pool	Fence & Gates	
Light Fixtures - Concrete Poles 11,888 Flooring Wood Floor - Family Gathering Room 18,723 Misc.Components Access Control System 6,501 Fitness Equip. Allowance (partial replacement) 5,572 Pool/Patio Furniture Allowance (partial replacement) 5,572 Playground Playground Equipment Allowance 46,437 Swimming Pool	Aluminum Gates/Fence- Entry	7,801
Flooring Wood Floor - Family Gathering Room 18,723 Misc.Components Access Control System Access Equip. Allowance (partial replacement) Fitness Equip. Allowance (partial replacement) Pool/Patio Furniture Allowance (partial replacement) Playground Playground Equipment Allowance Playming Pool	Site Lighting	
Wood Floor - Family Gathering Room 18,723 Misc.Components Access Control System 6,501 Fitness Equip. Allowance (partial replacement) 5,572 Pool/Patio Furniture Allowance (partial replacement) 5,572 Playground Playground Equipment Allowance 46,437 Swimming Pool	Light Fixtures - Concrete Poles	11,888
Misc.Components Access Control System 6,501 Fitness Equip. Allowance (partial replacement) 5,572 Pool/Patio Furniture Allowance (partial replacement) 5,572 Playground Playground Equipment Allowance 46,437 Swimming Pool	Flooring	
Access Control System 6,501 Fitness Equip. Allowance (partial replacement) 5,572 Pool/Patio Furniture Allowance (partial replacement) 5,572 Playground Playground Equipment Allowance 46,437 Swimming Pool	Wood Floor - Family Gathering Room	18,723
Fitness Equip. Allowance (partial replacement) 5,572 Pool/Patio Furniture Allowance (partial replacement) 5,572 Playground Playground Equipment Allowance 46,437 Swimming Pool	Misc.Components	
Pool/Patio Furniture Allowance (partial replacement) Playground Playground Equipment Allowance Swimming Pool 5,572 46,437	Access Control System	6,501
Playground Playground Equipment Allowance Swimming Pool 46,437	Fitness Equip. Allowance (partial replacement)	5,572
Playground Equipment Allowance 46,437 Swimming Pool	Pool/Patio Furniture Allowance (partial replacement)	5,572
Swimming Pool	Playground	
	Playground Equipment Allowance	46,437
	Swimming Pool	
	Filtration Equip Allowance (partial replacement)	5,572

Description	Expenditures
Replacement Year 42-43 continued Filtration System Refurishment Allowance	55,725
Total for 2042 - 2043	\$163,793
Replacement Year 43-44	
Exterior Painting Painting - Clubhouse Siding & Trim	32,683
Misc.Components Fitness Equip. Allowance (partial replacement) Pool/Patio Furniture Allowance (partial replacement)	5,768 5,768
HVAC Equipment HVAC Unit 2	15,380
Swimming Pool Filtration Equip Allowance (partial replacement)	5,768
Total for 2043 - 2044	\$65,365
Replacement Year 44-45	
Misc.Components Fitness Equip. Allowance (partial replacement) Pool/Patio Furniture Allowance (partial replacement)	5,969 5,969
Swimming Pool Filtration Equip Allowance (partial replacement) Pool Lift	5,969 11,226
Total for 2044 - 2045	\$29,134
Replacement Year 45-46	
Misc.Components Fitness Equip. Allowance (partial replacement) Pool/Patio Furniture Allowance (partial replacement)	6,178 6,178
Swimming Pool Filtration Equip Allowance (partial replacement)	6,178
Total for 2045 - 2046	\$18,535
Replacement Year 46-47	
Exterior Painting	0.400
Painting - Pool Slide Stairs	8,100

Description	Expenditures
Replacement Year 46-47 continued	
Misc.Components	
Fitness Equip. Allowance (partial replacement)	6,395
Pool/Patio Furniture Allowance (partial replacement)	6,395
HVAC Equipment	
HVAC Unit 1	17,905
Sport Courts	
Sport Court Resurfacing (color coat)	51,566
Swimming Pool	
Fiberglass Refurbish Allow - Pool Slide	61,814
Filtration Equip Allowance (partial replacement)	6,395
Refurbish Allowance - Pool Slide Frame	83,129
Total for 2046 - 2047	\$241,696
Replacement Year 47-48	
Fence & Gates	
Aluminum Fencing - Pool	164,956
Viny Ranch Fence - Tynes Blvd.	28,168
Parking Lots	
Asphalt Resurfacing - Phase II	102,571
Concrete Curbing Allow at Paving - Phase II	8,383
Cabinets & Tops	
Cabinets & Top - Outdoor Gathering	7,280
Misc.Components	
Fitness Equip. Replace Allowance	88,245
Pool/Patio Furniture Allowance (partial replacement)	6,618
Swimming Pool	
Concrete Pavers - Pool Deck/Patio	244,287
Filtration Equip Allowance (partial replacement)	6,618
Pool Splash Equipment Allowance	44,122
Shade Fabric - Pool	15,222
Splash Pad Equipment Allowance	92,657
Total for 2047 - 2048	\$809,128

Description	Expenditures
Replacement Year 48-49	
Misc.Components	
Fitness Equip. Allowance (partial replacement)	6,850
Pool/Patio Furniture Allowance (partial replacement)	6,850
HVAC Equipment	
HVAC Unit 3 A Condensor	13,700
HVAC Unit 3 B Condensor	8,220
Sport Courts	
Shade Structure Replacement - Sport Courts	34,250
Swimming Pool	
Filtration Equip Allowance (partial replacement)	6,850
Total for 2048 - 2049	\$76,720
Replacement Year 49-50	
Misc.Components	
Fitness Equip. Allowance (partial replacement)	7,090
Furniture Allowance - Clubhouse	28,359
Office Furniture	4,726
Pool/Patio Furniture Allowance (partial replacement)	7,090
Life Safety Systems	
Fire Alarm Panel	16,070
Swimming Pool	
Filtration Equip Allowance (partial replacement)	7,090
Total for 2049 - 2050	\$70,425
Replacement Year 50-51	
Misc.Components	
Fitness Equip. Allowance (partial replacement)	7,338
Pool/Patio Furniture Allowance (partial replacement)	7,338
Swimming Pool	
Filtration Equip Allowance (partial replacement)	7,338
Pool Resurfacing/Tile	287,743
Total for 2050 - 2051	\$309,756

Description	Expenditures
Replacement Year 51-52	
Misc.Components	
Ceiling Fans - Exterior	15,797
Fitness Equip. Allowance (partial replacement)	7,595
Pool/Patio Furniture Allowance (partial replacement)	7,595
Security Camera System Allowance	37,974
Swimming Pool	
Filtration Equip Allowance (partial replacement)	7,595
Total for 2051 - 2052	\$76,555
Replacement Year 52-53	
Fence & Gates	
Chain Link Fence VC - Sport Courts	185,634
Building Components	
Exterior Door/Window Allowance (Partial Replace)	104,807
Misc.Components	
Fitness Equip. Allowance (partial replacement)	7,861
Pool/Patio Furniture Allowance (partial replacement)	7,861
Playground	
Wood Benches/Tables	12,577
Sport Courts	
Drinking Fountain	12,577
Sport Court Replacement	505,117
Swimming Pool	
Filtration Equip Allowance (partial replacement)	7,861
Total for 2052 - 2053	\$844,293
Replacement Year 53-54	
Exterior Painting	
Painting - Clubhouse Siding & Trim	46,102
Misc.Components	
Fitness Equip. Allowance (partial replacement)	8,136
Pool/Patio Furniture Allowance (partial replacement)	8,136
Swimming Pool	
Filtration Equip Allowance (partial replacement)	8,136
Total for 2053 - 2054	\$70,509

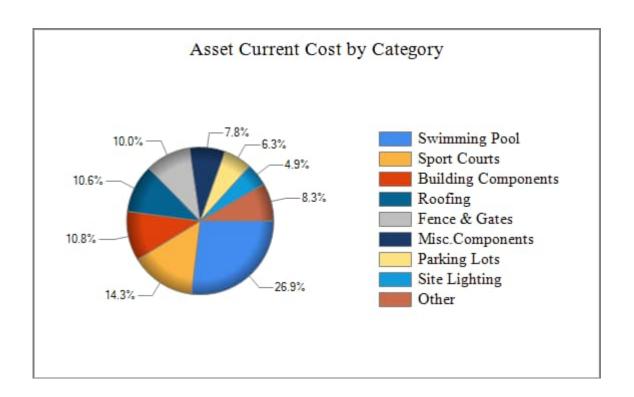

Pine Ridge Plantation CDD Component Inventory

Description			as.	gent		No.	. <u>5</u> 60		
Monument Sign (Large) Refurbishment 2008 25-26 15 3 1 1 Lump Sum 4,000.00 4,000 2,000 Monument Sign (Large) Refurbishment 2008 25-26 15 3 1 1 Lump Sum 4,000.00 2,000 2,000 Monument Sign (Small) Refurbishment 2008 25-26 15 3 1 1 Lump Sum 2,000.00 2,000 2,000 Misc. Site Components - Total Section 2,000 3,000	Description	Operation	ې موک ^ا مون	هٔ رچون	, dis	Section 19	Jäi ^t	المنتقد والمنتقد	Carlos
Monument Sign (Large) Refurbishment 2008 25-26 15 3 1 1 1 1 1 1 1 1 1	-	• •	•		٧	•	-		
Monument Sign (Small) Refurbishment 2008 25-26 15 3 1 1 1 1 1 1 1 1 2 2		2008	25-26	15	3	1	1 Lump Sum	4 000 00	4 000
Pence & Gates Secure Sec							-		
Aluminum Fencing - Pool 2023 47-48 25 0 23 804 Linear Feet 93.00 74,772 Aluminum Gates/Fence- Entry 2023 42-43 20 0 18 1 Lump Sum 4,200.00 4,200 70,848 Chain Link Fence VC - Sport Courts 2023 52-53 30 0 28 738 Linear Feet 96.00 70,848 Chain Link Fence VG - Sport Courts 2023 52-53 30 0 28 738 Linear Feet 48.00 2,304 Viny Ranch Fence - Tynes Blvd. 2023 47-48 25 0 28 304 Linear Feet 42.00 12,768 Fence & Gates - Total 2023 47-48 25 0 8 82 Linear Feet 32.00 2,624 5167,516								,	
Aluminum Gates/Fence-Entry 2023 42-43 20 0 18	Fence & Gates								
Chain Link Fence VC - Sport Courts 2023 52-53 30 0 28 738 Linear Feet 96.00 70.848 Chain Link Fence/Gates - Dumpster 2008 32-33 25 0 8 48 Linear Feet 48.00 2.304 Chain Link Fence Gates - Dumpster 2008 32-33 25 0 8 84 Linear Feet 48.00 2.304 Chain Fence - Tynes Blvd. 2023 47-48 25 0 23 304 Linear Feet 32.00 2.624 S167,516	Aluminum Fencing - Pool	2023	47-48	25	0	23	804 Linear Feet	93.00	74,772
Chain Link Fence/Gates - Dumpster 2008 32-33 25 0 8 48 Linear Feet 48.00 2.304 Viny Ranch Fence - Tynes Blvd. 2023 47-48 25 0 23 304 Linear Feet 42.00 12.768 Vinyl Fencie Fence & Gates - Total 2008 32-33 25 0 8 82 Linear Feet 32.00 2.624 \$167.516 Parking Lots	Aluminum Gates/Fence- Entry	2023	42-43	20	0	18	1 Lump Sum	4,200.00	4,200
Viny Ranch Fence - Tynes Blvd. 2023 47-48 25 0 23 304 Linear Feet 42.00 12,768 2.624 Fence & Gates - Total 2008 32-33 25 0 8 82 Linear Feet 32.00 2.624 5167,516 2.624 5167,516 2.624 5167,516 2.624 5167,516 2.624 5167,516 2.624 5167,516 2.624 5167,516 2.624 5167,516 2.624 5167,516 2.624 5167,516 2.624 5167,516 2.624 5167,516 2.624 5167,516 2.624	<u> •</u>		52-53	30	0	28			
Vinyl Fencing - Pine Ridge Pkwy Fence & Gates - Total 2.008 32-33 25 0 8 82 Linear Feet 32.00 2.624 \$167.516 \$	<u> •</u>								
Parking Lots									
Parking Lots Asphalt Resurfacing - Phase I 2008 32-33 25 0 8 2,400 Square Yards 21.00 50,400 Asphalt Resurfacing - Phase II 2023 47-48 25 0 23 2,214 Square Yards 21.00 46,494 Concrete Curbing Allow at Paving - Phase II 2008 32-33 25 0 8 100 Linear Feet 38.00 3,800 Concrete Curbing Allow at Paving - Phase II 2023 47-48 25 0 23 100 Linear Feet 38.00 3,800 Parking Lots - Total 2008 32-33 25 0 8 100 Linear Feet 38.00 3,800 Site Lighting Decorative Light Poles - Parking Lot 2008 32-33 25 0 8 6 Each 2,800.00 16,800 Decorative Light Poles - Palygound/Trail 2008 32-33 25 0 8 8 Each 3,900.00 31,200 Light Fixtures - Concrete Poles 2023 42-43 20		2008	32-33	25	0	8	82 Linear Feet	32.00	
Asphalt Resurfacing - Phase I 2008 32-33 25 0 8 2,400 Square Yards 21.00 46,404 Asphalt Resurfacing - Phase II 2023 47-48 25 0 23 2,214 Square Yards 21.00 46,494 Concrete Curbing Allow at Paving - Phase II 2023 47-48 25 0 23 100 Linear Feet 38.00 3,800 Concrete Curbing Allow at Paving - Phase II 2023 47-48 25 0 23 100 Linear Feet 38.00 \$3,800 Parking Lots - Total \$4-48 25 0 23 100 Linear Feet 38.00 \$3,800 \$104,494 \$25 0 23 100 Linear Feet \$3.00 \$3,800 \$104,494 \$25 0 23 100 Linear Feet \$3.00 \$3,800 \$104,494 \$25 0 23 100 Linear Feet \$3.00 \$3,800 \$104,494 \$25 0 23 100 Linear Feet \$3.00 \$3,800 \$104,494 \$25 0 23 100 Linear Feet \$3.00 \$3,800 \$104,494 \$25 0 23 100 Linear Feet \$3.00 \$3,800 \$104,494 \$25 0 23 100 Linear Feet \$3.00 \$3,800 \$104,494 \$25 0 23 100 Linear Feet \$3.00 \$3,800 \$104,494 \$25 0 20 10 Linear Feet \$3.00 \$3,800 \$104,494 \$25 0 20 10 Linear Feet \$3.00 \$3,800 \$104,494 \$25 0 20 10 Linear Feet \$3.00 \$3,800 \$104,494 \$25 0 20 10 Linear Feet \$3.00 \$3,800 \$104,494 \$25 0 28 10 Linear Feet \$3.00 \$3,800 \$2	Fence & Gates - Total								\$167,516
Asphalt Resurfacing - Phase II									
Concrete Curbing Allow at Paving - Phase I 2008 32-33 25 0 8 100 Linear Feet 38.00 3,800 3,800 Concrete Curbing Allow at Paving - Phase II 2023 47-48 25 0 23 100 Linear Feet 38.00 3,800 \$104,494 \$100 \$10									
Concrete Curbing Allow at Paving - Phase II 2023 47-48 25 0 23 100 Linear Feet 38.00 3,800 \$104,494 \$104 \$	1						-		
Parking Lots - Total \$104,494									
Site Lighting	-	2023	47-48	25	0	23	100 Linear Feet	38.00	
Decorative Light Poles - Parking Lot 2008 32-33 25 0 8 6 Each 2,800.00 16,800 Decorative Light Poles - Playgound/Trail 2008 32-33 25 0 8 10 Each 2,800.00 28,000 Decorative Light Poles - Pool 2008 32-33 25 0 8 8 Each 3,900.00 31,200 Light Fixtures - Concrete Poles 2023 42-43 20 0 18 8 Each 800.00 6,400	Parking Lots - Total								\$104,494
Decorative Light Poles - Parking Lot 2008 32-33 25 0 8 6 Each 2,800.00 16,800 Decorative Light Poles - Playgound/Trail 2008 32-33 25 0 8 10 Each 2,800.00 28,000 Decorative Light Poles - Pool 2008 32-33 25 0 8 8 Each 3,900.00 31,200 Light Fixtures - Concrete Poles 2023 42-43 20 0 18 8 Each 800.00 6,400	Site Lighting								
Decorative Light Poles - Pool 2008 32-33 25 0 8 8 Each 3,900.00 31,200		2008	32-33	25	0	8	6 Each	2,800.00	16,800
Light Fixtures - Concrete Poles 2023 42-43 20 0 18 8 Each 800.00 6,400 Site Lighting - Total 882,400 \$82,400 Building Components Exterior Door/Window Allowance (Partial R2008 52-53 45 0 28 1 Lump Sum 40,000.00 40,000 Folding Partition - Meeting Room 2008 37-38 30 0 13 13 Linear Feet 220.00 2,860 Refurbish Allowance - Clubhouse Restrooms 2008 34-35 25 2 10 260 Square Feet 128.00 33,280 Refurbish Allowance - Locker Rooms 2008 34-35 25 2 10 814 Square Feet 128.00 104,192 \$180,332 Roofing Metal Roof - Clubhouse 2008 37-38 30 0 13 12,200 Square Feet 14.20 173,240 Metal Roof - Pool Slide Tower 2008 37-38 30 0 13 80 Square Feet 36.00 2,880 Roofing - Total 37-38 30 0 13 80 Square Feet 36.	Decorative Light Poles - Playgound/Trail	2008	32-33	25	0	8	10 Each	2,800.00	28,000
Site Lighting - Total \$82,400	Decorative Light Poles - Pool	2008	32-33	25	0		8 Each	3,900.00	31,200
Building Components Exterior Door/Window Allowance (Partial R. 2008 52-53 45 0 28 1 Lump Sum 40,000.00 40,000 Folding Partition - Meeting Room 2008 37-38 30 0 13 13 Linear Feet 220.00 2,860 Refurbish Allowance - Clubhouse Restrooms 2008 34-35 25 2 10 260 Square Feet 128.00 33,280 Refurbish Allowance - Locker Rooms 2008 34-35 25 2 10 814 Square Feet 128.00 104,192 Building Components - Total 104,192 \$180,332 Roofing Metal Roof - Clubhouse Pool Slide Tower 2008 37-38 30 0 13 12,200 Square Feet 36.00 Pool Slide Tower 2008 37-38 30 0 13 80 Square Feet 36.00 2,880 Roofing - Total 14.20 173,240 173,2	=	2023	42-43	20	0	18	8 Each	800.00	
Exterior Door/Window Allowance (Partial R2008 52-53 45 0 28 1 Lump Sum 40,000.00 40,000 Folding Partition - Meeting Room 2008 37-38 30 0 13 13 Linear Feet 220.00 2,860 Refurbish Allowance - Clubhouse Restrooms 2008 34-35 25 2 10 260 Square Feet 128.00 33,280 Refurbish Allowance - Locker Rooms 2008 34-35 25 2 10 814 Square Feet 128.00 104,192 8180,332	Site Lighting - Total								\$82,400
Folding Partition - Meeting Room 2008 37-38 30 0 13 13 Linear Feet 220.00 2,860 Refurbish Allowance - Clubhouse Restrooms 2008 34-35 25 2 10 260 Square Feet 128.00 33,280 Refurbish Allowance - Locker Rooms 2008 34-35 25 2 10 814 Square Feet 128.00 104,192 Building Components - Total 8180,332 8180,332 8180,332 8180,332 Roofing 2008 37-38 30 0 13 12,200 Square Feet 14.20 173,240 Metal Roof - Pool Slide Tower 2008 37-38 30 0 13 80 Square Feet 36.00 2,880 Roofing - Total \$176,120 \$176,120 Cabinets & Top - Outdoor Gathering 2008 27-28 20 0 3 15 Linear Feet 220.00 3,300	Building Components								
Refurbish Allowance - Clubhouse Restrooms 2008 34-35 25 2 10 260 Square Feet 128.00 33,280 Refurbish Allowance - Locker Rooms 2008 34-35 25 2 10 814 Square Feet 128.00 104,192 Building Components - Total 814 Square Feet 128.00 104,192 \$180,332 Roofing Metal Roof - Clubhouse 2008 37-38 30 0 13 12,200 Square Feet 14.20 173,240 Metal Roof - Pool Slide Tower 2008 37-38 30 0 13 80 Square Feet 36.00 2,880 Roofing - Total \$176,120 \$176,120 Cabinets & Tops Cabinets & Top - Outdoor Gathering 2008 27-28 20 0 3 3 15 Linear Feet 220.00 3,300	Exterior Door/Window Allowance (Partial R	2008	52-53	45	0	28	1 Lump Sum	40,000.00	40,000
Refurbish Allowance - Locker Rooms Building Components - Total 2008 34-35 25 2 10 814 Square Feet 128.00 104,192 \$180,332 Roofing Metal Roof - Clubhouse Metal Roof - Pool Slide Tower Roofing - Total 2008 37-38 30 0 13 12,200 Square Feet 14.20 173,240 Metal Roof - Pool Slide Tower Roofing - Total 2008 37-38 30 0 13 80 Square Feet 36.00 2,880 S176,120 Cabinets & Tops Cabinets & Top - Outdoor Gathering 2008 27-28 20 0 3 15 Linear Feet 220.00 3,300	Folding Partition - Meeting Room	2008	37-38	30	0	13	13 Linear Feet	220.00	2,860
Building Components - Total \$180,332 Roofing Metal Roof - Clubhouse 2008 37-38 30 0 13 12,200 Square Feet 14.20 173,240 Metal Roof - Pool Slide Tower Roofing - Total 2008 37-38 30 0 13 80 Square Feet 36.00 2,880 \$176,120 Cabinets & Tops Cabinets & Top - Outdoor Gathering 2008 27-28 20 0 3 15 Linear Feet 220.00 3,300		2008	34-35		2		-		
Roofing Metal Roof - Clubhouse 2008 37-38 30 0 13 12,200 Square Feet 14.20 173,240 Metal Roof - Pool Slide Tower Roofing - Total 2008 37-38 30 0 13 80 Square Feet 36.00 2,880 Roofing - Total \$176,120 Cabinets & Tops Cabinets & Top - Outdoor Gathering 2008 27-28 20 0 3 15 Linear Feet 220.00 3,300		2008	34-35	25	2	10	814 Square Feet	128.00	
Metal Roof - Clubhouse 2008 37-38 30 0 13 12,200 Square Feet 14.20 173,240 Metal Roof - Pool Slide Tower Roofing - Total 2008 37-38 30 0 13 80 Square Feet 36.00 2,880 St76,120 Cabinets & Tops Cabinets & Top - Outdoor Gathering 2008 27-28 20 0 3 15 Linear Feet 220.00 3,300	Building Components - Total								\$180,332
Metal Roof - Pool Slide Tower Roofing - Total 2008 37-38 30 0 13 80 Square Feet 36.00 2,880 Strops Cabinets & Top - Outdoor Gathering 2008 27-28 20 0 3 15 Linear Feet 220.00 3,300	Roofing								
Roofing - Total \$176,120 Cabinets & Tops Strop - Outdoor Gathering 2008 27-28 20 0 3 15 Linear Feet 220.00 3,300	Metal Roof - Clubhouse	2008	37-38	30	0	13	12,200 Square Feet	14.20	173,240
Cabinets & Tops Cabinets & Top - Outdoor Gathering 2008 27-28 20 0 3 15 Linear Feet 220.00 3,300	Metal Roof - Pool Slide Tower	2008	37-38	30	0	13	80 Square Feet	36.00	2,880
Cabinets & Top - Outdoor Gathering 2008 27-28 20 0 3 15 Linear Feet 220.00 3,300	Roofing - Total								\$176,120
Cabinets & Top - Outdoor Gathering 2008 27-28 20 0 3 15 Linear Feet 220.00 3,300	Cabinets & Tops								
Cabinets & Tons - Meeting Area 2008 32-33 25 0 8 14 Linear Feet 320.00 4.480		2008	27-28	20	0	3	15 Linear Feet	220.00	3,300
Caome & Tops - Meeting Area 2000 32-33 23 0 0 14 Emedi Peti 320.00 4,400	Cabinets & Tops - Meeting Area	2008	32-33	25	0	8	14 Linear Feet	320.00	4,480
Cabinets & Tops - Serving Room 2008 32-33 25 0 8 29 Linear Feet 320.00 <u>9,280</u>		2008	32-33	25	0	8	29 Linear Feet	320.00	
Cabinets & Tops - Total \$17,060	Cabinets & Tops - Total								\$17,060

Pine Ridge Plantation CDD Component Inventory

	۵.	్ల త్ర	gent .		Soliding Soliding	₹		*
Description	Spirit in	50 76 V	هٔ ری ^{خ (}	V Sil	Sedig.	Jälis	عالمة المنافعة	Catalog Cost
Exterior Painting					_			
Painting - Clubhouse Siding & Trim Painting - Pool Slide Stairs Exterior Painting - Total	2024 2023	33-34 30-31	10 8	0	9 6	1 Lump Sum 1 Lump Sum	17,000.00 3,800.00	17,000 <u>3,800</u> \$20,800
Flooring								
Carpet - Clubhouse (replace with vinyl)	2008	24-25	8	0	0	450 Square Feet	8.40	3,780
Rubber Floor - Fitness Room	2008	32-33	25	0	8	76 Square Yards	58.00	4,408
Tile Floor - Serving Room	2008	32-33	25	0	8	260 Square Feet	12.75	3,315
Vinyl Plank Floor - Activity Room/Corridor	2008	32-33	25	0	8	685 Square Feet	8.40	5,754
Wood Floor - Family Gathering Room Flooring - Total	2008	42-43	35	0	18	840 Square Feet	12.00	$\frac{10,080}{$27,337}$
Misc.Components								
Access Control System	2008	27-28	15	5	3	1 Lump Sum	3,500.00	3,500
Ceiling Fans - Exterior	2022	36-37	15	0	12	13 Each	480.00	6,240
Ceiling Fans - Family Gathering Room	2022	41-42	20	0	17	3 Each	480.00	1,440
Ceiling Fans - Fitness Center	2022	39-40	15	3	15	3 Each	480.00	1,440
Fitness Equip. Allowance (partial replaceme	2008	24-25	1	0	0	1 Lump Sum	3,000.00	3,000
Fitness Equip. Replace Allowance	2008	47-48	40	0	23	1 Lump Sum	40,000.00	40,000
Furniture Allowance - Clubhouse	2008	29-30	20	2	5	1 Lump Sum	12,000.00	12,000
Office Furniture	2008	29-30	20	2	5	1 Lump Sum	2,000.00	2,000
Pool/Patio Furniture Allowance (partial rep	1.2008	24-25	1	0	0	1 Lump Sum	3,000.00	3,000
Pool/Patio Furniture Replacement Allowance	e 2008	32-33	25	0	8	1 Lump Sum	42,000.00	42,000
Security Camera System Allowance	2022	36-37	15	0	12	1 Lump Sum	15,000.00	15,000
Misc.Components - Total								\$129,620
HVAC Equipment								
Air Handler (refurbished)	2019	39-40	20	0	15	1 Lump Sum	5,000.00	5,000
HVAC Unit 1	2023	34-35	12	0	10	7 Tons	1,200.00	8,400
HVAC Unit 2	2019	31-32	12	0	7	5 Tons	1,600.00	8,000
HVAC Unit 3 A Condensor	2008	24-25	12	0	0	5 Tons	1,200.00	6,000
HVAC Unit 3 B Condensor	2008	24-25	12	0	0	3 Tons	1,200.00	3,600
HVAC Equipment - Total								\$31,000
Life Safety Systems								
Fire Alarm Panel	2008	29-30	20	2	5	1 Lump Sum	6,800.00	6,800
Life Safety Systems - Total								\$6,800
Playground								
Playground Equipment Allowance	2013	27-28	15	0	3	1 Lump Sum	25,000.00	25,000
Wood Benches/Tables	2013	32-33	20	0	8	4 Each	1,200.00	4,800
Playground - Total								\$29,800

Pine Ridge Plantation CDD Component Inventory

		4	gent		eri.	:5°0		
Description	Operation of the control of the cont	\$ 200 AS	, sp 25		A State of the sta	Silis		CHÍ CÓ
Sport Courts								
Drinking Fountain	2023	52-53	30	0	28	1 Each	4,800.00	4,800
Shade Fabric - Sport Courts	2023	36-37	14	0	12	1 Each	2,300.00	2,300
Shade Structure Replacement - Sport Courts	2023	48-49	26	0	24	1 Each	15,000.00	15,000
Sport Court Replacement	2023	52-53	30	0	28	2,520 Square Yards	76.50	192,780
Sport Court Resurfacing (color coat)	2023	30-31	8	0	6	2,520 Square Yards	9.60	24,192
Sport Courts - Total								\$239,072
Swimming Pool								
Concrete Pavers - Pool Deck/Patio	2008	47-48	40	0	23	14,570 Square Feet	7.60	110,732
Fiberglass Refurbish Allow - Pool Slide	2023	34-35	12	0	10	1 Lump Sum	29,000.00	29,000
Filtration Equip Allowance (partial replace	2008	24-25	1	0	0	1 Lump Sum	3,000.00	3,000
Filtration System Refurishment Allowance	2008	42-43	35	0	18	1 Lump Sum	30,000.00	30,000
Pool Lift	2021	32-33	12	0	8	1 Each	5,642.00	5,642
Pool Resurfacing/Tile	2015	26-27	12	0	2	3,460 Square Feet	34.00	117,640
Pool Splash Equipment Allowance	2008	27-28	20	0	3	1 Lump Sum	20,000.00	20,000
Refurbish Allowance - Pool Slide Frame	2023	34-35	12	0	10	1 Lump Sum	39,000.00	39,000
Shade Fabric - Pool	2024	47-48	14	10	23	3 Each	2,300.00	6,900
Shade Structure Replacement	2008	33-34	26	0	9	3 Each	15,000.00	45,000
Splash Pad Equipment Allowance	2023	47-48	25	0	23	1 Lump Sum	42,000.00	42,000
Swimming Pool - Total								\$448,914

Operating Expense

Operating Expense	
Backflow Preventer Repair	Unfunded
Electrical Panels/Disconnects	Unfunded
Fire Detection Devices	Unfunded
Flag Pole	Unfunded
Grills	Unfunded
Interior Painting - Clubhouse	Unfunded
Laminated Beam Repair	Unfunded
Message Board	Unfunded
Painting - Entry Features	Unfunded
Painting - Pool Equipment Yard	Unfunded
Pendent Lights - Breezeway	Unfunded
Refrigerator	Unfunded
Splash Pad Coating/Repair	Unfunded
Sport Court Nets/Equipment	Unfunded
Trash Cans/ Misc. Site Furnishings	Unfunded
Water Coolers - Clubhouse	Unfunded
Water Heater - Clubhouse	Unfunded
Operating Expense - Total	

Not Included

Backflow Preventer Replacement Unfunded
Building Foundation/Frame Unfunded

Pine Ridge Plantation CDD Component Inventory

Description		into line		Carlor Cos
Description		₩.	5 0	0 0
Not Included continued				
Communication Wiring/Devices in Building	Unfunded			
Electrical Wiring/Devices in Building	Unfunded			
Light Poles (Concrete) - Parking Lot	Unfunded			
Siding/Trim Replacement	Unfunded			
= =				

Unfunded

Unfunded

Not Included - Total

Site Utilities

Components Removed

Wood Pergolas - Entry Signs Unfunded

Components Removed - Total

Water/Sewer/Vent Piping In building

Total Asset Summary \$1,667,265

Asset I	DDescription	Replacement	Page
Misc. S	Site Components		
1005	Monument Sign (Large) Refurbishment	25-26	5-9
1006	Monument Sign (Small) Refurbishment	25-26	5-9
Fence of	& Gates		
1047	Aluminum Fencing - Pool	47-48	5-11
1049	Aluminum Gates/Fence- Entry	42-43	5-11
	Chain Link Fence VC - Sport Courts	52-53	5-12
1051	Chain Link Fence/Gates - Dumpster	32-33	5-12
1048	Viny Ranch Fence - Tynes Blvd.	47-48	5-13
1050	Vinyl Fencing - Pine Ridge Pkwy	32-33	5-13
Parkin	g Lots		
1001	Asphalt Resurfacing - Phase I	32-33	5-14
1001	Asphalt Resurfacing - Phase II	47-48	5-14
1002	Concrete Curbing Allow at Paving - Phase I	32-33	5-15
1002	Concrete Curbing Allow at Paving - Phase II	47-48	5-15
Site Li	ghting		
1070	Decorative Light Poles - Parking Lot	32-33	5-16
1062	Decorative Light Poles - Playgound/Trail	32-33	5-16
1069	Decorative Light Poles - Pool	32-33	5-17
1071	Light Fixtures - Concrete Poles	42-43	5-17
Buildir	ng Components		
	Exterior Door/Window Allowance (Partial Replace)	52-53	5-18
1013	Folding Partition - Meeting Room	37-38	5-18
	Refurbish Allowance - Clubhouse Restrooms	34-35	5-19
	Refurbish Allowance - Locker Rooms	34-35	5-19
Roofin	g		
1073	Metal Roof - Clubhouse	37-38	5-21
1072	Metal Roof - Pool Slide Tower	37-38	5-21
Cabine	ets & Tops		
1089	Cabinets & Top - Outdoor Gathering	27-28	5-23
1085	Cabinets & Tops - Meeting Area	32-33	5-23
1086	Cabinets & Tops - Serving Room	32-33	5-24

Asset ID Description		Replacement	Page					
Exterio	or Painting							
1075	Painting - Clubhouse Siding & Trim	33-34	5-25					
1077	Painting - Pool Slide Stairs	30-31	5-25					
Floorin	ng							
1040	Carpet - Clubhouse (replace with vinyl)	24-25	5-26					
1041	Rubber Floor - Fitness Room	32-33	5-26					
1045	Tile Floor - Serving Room	32-33	5-27					
1043	Vinyl Plank Floor - Activity Room/Corridor	32-33	5-27					
1044	Wood Floor - Family Gathering Room	42-43	5-27					
Misc.C	Components							
1065	Access Control System	27-28	5-29					
1064	Ceiling Fans - Exterior	36-37	5-29					
1067	Ceiling Fans - Family Gathering Room	41-42	5-29					
1063	Ceiling Fans - Fitness Center	39-40	5-30					
1029	Fitness Equip. Allowance (partial replacement)	24-25	5-30					
1029	Fitness Equip. Replace Allowance	47-48	5-31					
	Furniture Allowance - Clubhouse	29-30	5-32					
1028	Office Furniture	29-30	5-32					
1030	Pool/Patio Furniture Allowance (partial replacement)	24-25	5-33					
1030	Pool/Patio Furniture Replacement Allowance	32-33	5-33					
1066	Security Camera System Allowance	36-37	5-34					
HVAC	Equipment							
1059	Air Handler (refurbished)	39-40	5-35					
1061	HVAC Unit 1	34-35	5-35					
1060	HVAC Unit 2	31-32	5-36					
1060	HVAC Unit 3 A Condensor	24-25	5-36					
1060	HVAC Unit 3 B Condensor	24-25	5-36					
Life Sa	afety Systems							
1068	Fire Alarm Panel	29-30	5-37					
Plavgr	Playground							
1036	Playground Equipment Allowance	27-28	5-38					
1035	Wood Benches/Tables	32-33	5-38					

Asset I	DDescription	Replacement	Page
Sport (Courts		
_	Drinking Fountain	52-53	5-39
1022	Shade Fabric - Sport Courts	36-37	5-39
	Shade Structure Replacement - Sport Courts	48-49	5-40
	Sport Court Replacement	52-53	5-40
	Sport Court Resurfacing (color coat)	30-31	5-41
Swimn	ning Pool		
SWIIII	Concrete Pavers - Pool Deck/Patio	47-48	5-42
1020	Fiberglass Refurbish Allow - Pool Slide	34-35	5-42
1025	Filtration Equip Allowance (partial replacement)	24-25	5-43
1025	Filtration System Refurishment Allowance	42-43	5-43
1021	Pool Lift	32-33	5-44
1018	Pool Resurfacing/Tile	26-27	5-44
1017	Pool Splash Equipment Allowance	27-28	5-45
1024	Refurbish Allowance - Pool Slide Frame	34-35	5-45
1022	Shade Fabric - Pool	47-48	5-46
1023	Shade Structure Replacement	33-34	5-46
	Splash Pad Equipment Allowance	47-48	5-47
Operat	ting Expense		
•	Backflow Preventer Repair	24-25	5-48
	Electrical Panels/Disconnects	24-25	5-48
1071	Fire Detection Devices	24-25	5-49
	Flag Pole	24-25	5-49
	Grills	24-25	5-49
1074	Interior Painting - Clubhouse	24-25	5-50
	Laminated Beam Repair	24-25	5-50
	Message Board	24-25	5-51
1081	Painting - Entry Features	24-25	5-51
1078	Painting - Pool Equipment Yard	24-25	5-51
	Pendent Lights - Breezeway	24-25	5-52
1034	Refrigerator	24-25	5-52
	Splash Pad Coating/Repair	24-25	5-53
	Sport Court Nets/Equipment	24-25	5-53
	Trash Cans/ Misc. Site Furnishings	24-25	5-54
1053	Water Coolers - Clubhouse	24-25	5-54
1057	Water Heater - Clubhouse	24-25	5-55

Asset I	DDescription	Replacement	Page
Not Inc	cluded		
	Backflow Preventer Replacement	24-25	5-56
1071	Building Foundation/Frame	24-25	5-56
1071	Communication Wiring/Devices in Building	24-25	5-56
1071	Electrical Wiring/Devices in Building	24-25	5-57
1071	Light Poles (Concrete) - Parking Lot	24-25	5-57
1071	Siding/Trim Replacement	24-25	5-57
1071	Site Utilities	24-25	5-58
1071	Water/Sewer/Vent Piping In building	24-25	5-58
Compo			
1004	Wood Pergolas - Entry Signs	24-25	5-59
	Total Funded Assets	67	
	Total Unfunded Assets	<u>26</u>	
	Total Assets	93	

Monument Sign (Large) Refurbishment - 2025

Asset ID	1005	1 Lump Sum Asset Actual Cost Percent Replacement	@ \$4,000.00 \$4,000.00 100%
Category M	isc. Site Components	Future Cost	\$4,140.00
Placed in Service	June 2008	1 00010 0000	Ψ.,1.0.00
Useful Life	15		
Adjustment	3		
Replacement Year	25-26		
Remaining Life	1		



Monument Sign (Small) Refurbishment - 2025

Asset ID	1006	1 Lump Sum Asset Actual Cost Percent Replacement	@ \$2,000.00 \$2,000.00 100%
Category Mi	sc. Site Components	Future Cost	\$2,070.00
Placed in Service	June 2008		
Useful Life	15		
Adjustment	3		
Replacement Year	25-26		
Remaining Life	1		

Monument Sign (Small) Refurbishment continued...



Aluminum Fencing - Pool - 2047

Asset ID 1047

804 Linear Feet @ \$93.00 Asset Actual Cost \$74,772.00 Percent Replacement 100% Future Cost \$164,955.59

Category Fence & Gates
Placed in Service March 2023
Useful Life 25
Replacement Year 47-48
Remaining Life 23



Aluminum Gates/Fence- Entry - 2042

Asset ID 1049

1 Lump Sum @ \$4,200.00
Asset Actual Cost \$4,200.00
Percent Replacement 100%
Future Cost \$7,801.45

Category Fence & Gates
Placed in Service June 2023
Useful Life 20
Replacement Year 42-43
Remaining Life 18



Chain Link Fence VC - Sport Courts - 2052

		738 Linear Feet	@ \$96.00
Asset ID		Asset Actual Cost	\$70,848.00
		Percent Replacement	100%
Category	Fence & Gates	Future Cost	\$185,633.94

Category Fence & Gates
Placed in Service June 2023
Useful Life 30
Replacement Year 52-53
Remaining Life 28



Chain Link Fence/Gates - Dumpster - 2032

Asset ID	1051	48 Linear Feet Asset Actual Cost Percent Replacement	@ \$48.00 \$2,304.00 100%
Cotogomy	Fence & Gates	Future Cost	\$3,033.93
Category		rutule Cost	\$3,033.93
Placed in Service	June 2008		
Useful Life	25		
Replacement Year	32-33		
Remaining Life	8		



Community Advisors Page 5-12 May 18, 2024

Viny Ranch Fence - Tynes Blvd. - 2047

Asset ID	1048	304 Linear Feet Asset Actual Cost Percent Replacement	@ \$42.00 \$12,768.00 100%
Category	Fence & Gates	Future Cost	\$28,167.67
Placed in Service	March 2023		
Useful Life	25		
Replacement Year	47-48		
Remaining Life	23		



Vinyl Fencing - Pine Ridge Pkwy - 2032

		82 Linear Feet	@ \$32.00
Asset ID	1050	Asset Actual Cost	\$2,624.00
		Percent Replacement	100%
Category	Fence & Gates	Future Cost	\$3,455.31
Placed in Service	June 2008		
Useful Life	25		
Replacement Year	32-33		
Remaining Life	8		



Community Advisors Page 5-13 May 18, 2024

Asphalt Resurfacing - Phase I - 2032

Asset ID	1001	2,400 Square Yards Asset Actual Cost Percent Replacement	@ \$21.00 \$50,400.00 100%
Category	Parking Lots	Future Cost	\$66,367.18
Placed in Service	June 2008		
Useful Life	25		
Replacement Year	32-33		
Remaining Life	8		



Asphalt Resurfacing - Phase II - 2047

		2,214 Square Yards	@ \$21.00
Asset ID	1001	Asset Actual Cost	\$46,494.00
		Percent Replacement	100%
Category	Parking Lots	Future Cost	\$102,571.09
Placed in Service	June 2023		
Useful Life	25		
Replacement Year	47-48		
Remaining Life	23		



Community Advisors Page 5-14 May 18, 2024

Concrete Curbing Allow at Paving - Phase I - 2032

Asset ID	1002	100 Linear Feet Asset Actual Cost	@ \$38.00 \$3,800.00
		Percent Replacement	100%
Category	Parking Lots	Future Cost	\$5,003.87
Placed in Service	June 2008		
Useful Life	25		
Replacement Year	32-33		
Remaining Life	8		



Concrete Curbing Allow at Paving - Phase II - 2047

Asset ID	1002	100 Linear Feet Asset Actual Cost Percent Replacement	@ \$38.00 \$3,800.00 100%
Category	Parking Lots	Future Cost	\$8,383.23
Placed in Service	June 2023		
Useful Life	25		
Replacement Year	47-48		
Remaining Life	23		



Community Advisors Page 5-15 May 18, 2024

Decorative Light Poles - Parking Lot - 2032

Asset ID	1070	6 Each Asset Actual Cost Percent Replacement	@ \$2,800.00 \$16,800.00 100%
Category	Site Lighting	Future Cost	\$22,122.39
Placed in Service	June 2008		
Useful Life	25		
Replacement Year	32-33		
Remaining Life	8		



Decorative Light Poles - Playgound/Trail - 2032

Asset ID	1062	10 Each Asset Actual Cost Percent Replacement	@ \$2,800.00 \$28,000.00 100%
Category	Site Lighting	Future Cost	\$36,870.65
Placed in Service	June 2008		
Useful Life	25		
Replacement Year	32-33		
Remaining Life	8		



Community Advisors Page 5-16 May 18, 2024

Decorative Light Poles - Pool - 2032

 Light Poles - Pool - 2032
 8 Each
 @ \$3,900.00

 Asset ID
 1069
 Asset Actual Cost
 \$31,200.00

 Percent Replacement
 100%

 Category
 Site Lighting
 Future Cost
 \$41,084.44

Placed in Service June 2008
Useful Life 25
Replacement Year 32-33
Remaining Life 8



Light Fixtures - Concrete Poles - 2042

Asset ID 1071 Asset Actual Cost

Category Site Lighting
Placed in Service June 2023
Useful Life 20
Replacement Year 42-43
Remaining Life 18

8 Each @ \$800.00
Asset Actual Cost \$6,400.00
Percent Replacement 100%
Future Cost \$11,887.93



Exterior Door/Window Allowance (Partial Replace) - 2052

Asset ID 1 Lump Sum @ \$40,000.00
Asset Actual Cost \$40,000.00
Percent Replacement 100%

Category Building Components
Placed in Service
Useful Life
45
Replacement Year
Remaining Life
28





Future Cost

\$104,806.88

Folding Partition - Meeting Room - 2037

Asset ID 1013 Asset Actual Cost \$2,860.00
Percent Replacement 100%
Category Building Components Future Cost \$4,472.91

Category Building Components
Placed in Service
Useful Life
Replacement Year
Remaining Life
Building Components
June 2008
37-38

Refurbish Allowance - Clubhouse Restrooms - 2034

Asset ID		260 Square Feet Asset Actual Cost Percent Replacement	@ \$128.00 \$33,280.00 100%
Category	Building Components	Future Cost	\$46,944.73
Placed in Service	June 2008		
Useful Life	25		
Adjustment	2		
Replacement Year	34-35		



10

Refurbish Allowance - Locker Rooms - 2034

Remaining Life

Asset ID		814 Square Feet Asset Actual Cost Percent Replacement	@ \$128.00 \$104,192.00 100%
Category	Building Components	Future Cost	\$146,973.11
Placed in Service	June 2008		
Useful Life	25		
Adjustment	2		
Replacement Year	34-35		
Remaining Life	10		

Refurbish Allowance - Locker Rooms continued...



Metal Roof - Clubhouse - 2037

Roof - Clubhouse - 2037		12,200 Square Feet	@ \$14.20
Asset ID	1073	Asset Actual Cost	\$173,240.00
		Percent Replacement	100%
Category	Roofing	Future Cost	\$270,939.75

Placed in Service June 2008 Useful Life 30 Replacement Year 37-38 Remaining Life 13



Metal is discolored from previous cleaning. Recommend inspection, cleaning and repair as needed.

Metal Roof - Pool Slide Tower - 2037

Asset ID	1072	80 Square Feet Asset Actual Cost Percent Replacement	@ \$36.00 \$2,880.00 100%
Category	Roofing	Future Cost	\$4,504.19
Placed in Service	June 2008		
Useful Life	30		
Replacement Year	37-38		
Remaining Life	13		

Metal Roof - Pool Slide Tower continued...



Cabinets & Top - Outdoor Gathering - 2027

Asset ID 1089 Asset Actual Cost \$3,300.00
Percent Replacement 100%
Category Cabinets & Tops Future Cost \$3,658.77

Placed in Service
Useful Life
Replacement Year
Remaining Life

June 2008
27-28
3





Cabinets & Tops - Meeting Area - 2032

Asset ID 1085 Asset Actual Cost \$4,480.00
Percent Replacement 100%
Category Cabinets & Tops Future Cost \$5,899.30

Category Cabinets & Tops
Placed in Service June 2008
Useful Life 25
Replacement Year 32-33
Remaining Life 8



Community Advisors Page 5-23 May 18, 2024

Cabinets & Tops - Serving Room - 2032

Asset ID	1086	29 Linear Feet Asset Actual Cost Percent Replacement	@ \$320.00 \$9,280.00 100%
Category	Cabinets & Tops	Future Cost	\$12,219.99
Placed in Service	June 2008		
Useful Life	25		
Replacement Year	32-33		
Remaining Life	8		



Painting - Clubhouse Siding & Trim - 2033

Asset ID 1075 Asset Actual Cost \$17,000.00
Percent Replacement 100%
Category Exterior Painting Future Cost \$23,169.25
Placed in Service March 2024

Useful Life 10
Replacement Year 33-34
Remaining Life 9



Painting - Pool Slide Stairs - 2030


Asset ID 1077 Asset Actual Cost \$3,800.0

Category Exterior Painting
Placed in Service March 2023
Useful Life 8
Replacement Year 30-31
Remaining Life 6



Carpet - Clubhouse (replace with vinyl) - 2024

		450 Square Feet	@ \$8.40
Asset ID	1040	Asset Actual Cost	\$3,780.00
		Percent Replacement	100%
Category	Flooring	Future Cost	\$3,780.00
Placed in Service	June 2008		
Useful Life	8		
Replacement Year	24-25		
Remaining Life	0		

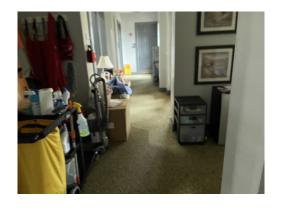

Rubber Floor - Fitness Room - 2032

		76 Square Yards	@ \$58.00
Asset ID	1041	Asset Actual Cost	\$4,408.00
		Percent Replacement	100%
Category	Flooring	Future Cost	\$5,804.49
Placed in Service	June 2008		
Useful Life	25		
Replacement Year	32-33		
Remaining Life	8		
Placed in Service Useful Life Replacement Year	June 2008 25 32-33	•	



Community Advisors Page 5-26 May 18, 2024

Tile Floor - Serving Room	m - 2032	260 Square Feet	@ \$12.75
Asset ID	1045	Asset Actual Cost	\$3,315.00
		Percent Replacement	100%
Category	Flooring	Future Cost	\$4,365.22
Placed in Service	June 2008		
Useful Life	25		
Replacement Year	32-33		
Remaining Life	8		

Vinyl Plank Floor - Activity Room/Corridor - 2032

Asset ID	1043	685 Square Feet Asset Actual Cost Percent Replacement	@ \$8.40 \$5,754.00 100%
Category	Flooring	Future Cost	\$7,576.92
Placed in Service	June 2008		
Useful Life	25		
Replacement Year	32-33		
Remaining Life	8		



Wood Floor - Family Gathering Room - 2042

	840 Square Feet	@ \$12.00
1044	Asset Actual Cost	\$10,080.00
	Percent Replacement	100%
Flooring	Future Cost	\$18,723.49
June 2008		
35		
42-43		
18		
	Flooring June 2008 35 42-43	1044 Asset Actual Cost Percent Replacement Flooring June 2008 35 42-43

Wood Floor - Family Gathering Room continued...



Access Contro	l System -	2027
---------------	------------	------

 htrol System - 2027
 1 Lump Sum @ \$3,500.00

 Asset ID
 1065
 Asset Actual Cost Percent Replacement
 \$3,500.00

 Percent Replacement
 100%

 Category
 Misc.Components
 Future Cost
 \$3,880.51

Placed in Service June 2008
Useful Life 15
Adjustment 5
Replacement Year 27-28
Remaining Life 3

Ceiling Fans - Exterior - 2036

Asset ID 1064 Asset Actual Cost \$6,240.00
Percent Replacement 100%
Category Misc.Components Future Cost \$9,429.07

Category Misc.Components
Placed in Service June 2022
Useful Life 15
Replacement Year 36-37
Remaining Life 12



Ceiling Fans - Family Gathering Room - 2041

Replacement Year

Remaining Life

		3 Each	@ \$480.00
Asset ID	1067	Asset Actual Cost	\$1,440.00
		Percent Replacement	100%
Category	Misc.Components	Future Cost	\$2,584.33
Placed in Service	June 2022		
Useful Life	20		

41-42

17

Ceiling Fans - Family Gathering Room continued...



Ceiling Fans - Fitness	Center - 2039	3 Each	@ \$480.00
Asset ID	1063	Asset Actual Cost Percent Replacement	\$1,440.00 100%
Category	Misc.Components	Future Cost	\$2,412.50
Placed in Service	June 2022		
Useful Life	15		
Adjustment	3		
Replacement Year	39-40		
Remaining Life	15		

Fitness Equip. Allowance (partial replacement) - 2024

Asset ID	1029	1 Lump Sum Asset Actual Cost Percent Replacement	@ \$3,000.00 \$3,000.00 100%
Category	Misc.Components	Future Cost	\$3,000.00
Placed in Service	June 2008		
Useful Life	1		
Replacement Year	24-25		
Remaining Life	0		

Fitness Equip. Allowance (partial replacement) continued...



Fitness Equip. Replace Allowance - 2047

		1 Lump Sum	@ \$40,000.00
Asset ID	1029	Asset Actual Cost	\$40,000.00
		Percent Replacement	100%
Category	Misc.Components	Future Cost	\$88,244.58
Placed in Service	June 2008		
Useful Life	40		
Replacement Year	47-48		
Remaining Life	23		



Furniture Allowance - Clubhouse - 2029

		1 Lump Sum	@ \$12,000.00
Asset ID		Asset Actual Cost	\$12,000.00
		Percent Replacement	100%
Category	Misc.Components	Future Cost	\$14,252.24

Category	Misc.Components
Placed in Service	June 2008
Useful Life	20
Adjustment	2
Replacement Year	29-30
Remaining Life	5



Office Furniture - 2029

niture - 2029	9	1 Lump Sum	@ \$2,000.00
Asset ID	1028	Asset Actual Cost	\$2,000.00
		Percent Replacement	100%
Category	Misc Components	Future Cost	\$2,375,37

Category	wise.components
Placed in Service	June 2008
Useful Life	20
Adjustment	2
Replacement Year	29-30
Remaining Life	5

Pool/Patio Furniture Allowance (partial replacement) - 2024

		1 Lump Sum	@ \$3,000.00
Asset ID	1030	Asset Actual Cost	\$3,000.00
		Percent Replacement	100%
Category	Misc.Components	Future Cost	\$3,000.00
Placed in Service	June 2008		
Useful Life	1		
Replacement Year	24-25		
Remaining Life	0		



Pool/Patio Furniture Replacement Allowance - 2032

Asset ID	1030	1 Lump Sum Asset Actual Cost	@ \$42,000.00 \$42,000.00
		Percent Replacement	100%
Category	Misc.Components	Future Cost	\$55,305.98
Placed in Service	June 2008		
Useful Life	25		
Replacement Year	32-33		
Remaining Life	8		



Community Advisors Page 5-33 May 18, 2024

Security Camera System Allowance - 2036

		1 Lump Sum	@ \$15,000.00
Asset ID	1066	Asset Actual Cost	\$15,000.00
		Percent Replacement	100%
Category	Misc.Components	Future Cost	\$22,666.03
Placed in Service	August 2022		
Useful Life	15		
Replacement Year	36-37		
Remaining Life	12		

Air Handler (refurbished) - 2039

Asset ID 1059

Category Placed in Service November 2019
Useful Life 20
Replacement Year Remaining Life 15



1061

HVAC Unit 1 - 2034

Asset ID

Category HVAC Equipment
Placed in Service July 2023
Useful Life 12
Replacement Year 34-35
Remaining Life 10



HVAC Unit 2 - 2031

@ \$1,600.00 Asset ID 1060 **Asset Actual Cost** \$8,000.00 Percent Replacement 100% **Future Cost** \$10,178.23

5 Tons

HVAC Equipment Category Placed in Service November 2019 Useful Life 12 Replacement Year 31-32 Remaining Life 7



HVAC Unit 3 A Condensor - 2024

5 Tons @ \$1,200.00 1060 Asset Actual Cost Asset ID \$6,000.00 Percent Replacement 100% **HVAC** Equipment **Future Cost** \$6,000.00

Category Placed in Service December 2008 Useful Life 12 Replacement Year 24-25 Remaining Life 0

HVAC Unit 3 B Condensor - 2024

3 Tons @ \$1,200.00 1060 Asset Actual Cost Asset ID \$3,600.00 Percent Replacement 100% **HVAC** Equipment **Future Cost** \$3,600.00

Category Placed in Service December 2008 Useful Life 12 Replacement Year 24-25 Remaining Life 0

Fire Alarm Panel - 2029

 Panel - 2029
 1 Lump Sum
 @ \$6,800.00

 Asset ID
 1068
 Asset Actual Cost
 \$6,800.00

 Percent Replacement
 100%

 Category
 Life Safety Systems
 Future Cost
 \$8,076.27

Placed in Service
Useful Life
Adjustment
Replacement Year
Remaining Life
Life Safety Systems
June 2008
20
20
21
22
29-30
29-30





Playground Equipment Allowance - 2027

		1 Lump Sum	@ \$25,000.00
Asset ID	1036	Asset Actual Cost	\$25,000.00
		Percent Replacement	100%
Category	Playground	Future Cost	\$27,717.95
Placed in Service	June 2013		
Useful Life	15		
Replacement Year	27-28		
Remaining Life	3		





Wood Benches/Tables - 2032

nes/Tables - A	2032	4 Each	@ \$1,200.00
Asset ID	1035	Asset Actual Cost	\$4,800.00
		Percent Replacement	100%
Category	Playground	Future Cost	\$6,320.68

Placed in Service June 2013
Useful Life 20
Replacement Year 32-33
Remaining Life 8



Drinking Fountain - 2052

Asset ID

Category	Sport Courts
Placed in Service	March 2023
Useful Life	30
Replacement Year	52-53
Remaining Life	28



Shade Fabric - Sport Courts - 2036

Asset ID 1022

Sport Courts
March 2023
14
36-37
12



Shade fabric scheduled for replacement in FY 2036 as a one time replacement. The next cycle

Shade Fabric - Sport Courts continued...

of fabric replacement projected to occur in FY 2048 at time of frame and fabric replacement.

Shade Structure Replacement - Sport Courts - 2048

		1 Each	@ \$15,000.00
Asset ID		Asset Actual Cost	\$15,000.00
		Percent Replacement	100%
Category	Sport Courts	Future Cost	\$34,249.93
Placed in Service	March 2023		
Useful Life	26		
Replacement Year	48-49		
Remaining Life	24		



Shade structure and fabric projected replacement in FY 2048 as a one time replacement.

Sport Court Replacement	nt - 2052	2,520 Square Yards	@ \$76.50
Asset ID		Asset Actual Cost	\$192,780.00
		Percent Replacement	100%
Category	Sport Courts	Future Cost	\$505,116.75
Placed in Service	June 2023		
Useful Life	30		
Replacement Year	52-53		
Remaining Life	28		

Sport Court Replacement continued...



Sport Court Resurfacing (color coat) - 2030

Asset ID

Category Sport Courts
Placed in Service June 2023
Useful Life 8
Replacement Year 30-31
Remaining Life 6

 2,520 Square Yards
 @ \$9.60

 Asset Actual Cost
 \$24,192.00

 Percent Replacement
 100%

 Future Cost
 \$29,738.14



Concrete Pavers - Pool Deck/Patio - 2047

		14,570 Square Feet	@ \$7.60
Asset ID		Asset Actual Cost	\$110,732.00
		Percent Replacement	100%
Category	Swimming Pool	Future Cost	\$244,287,47

Category Swimming Pool
Placed in Service June 2008
Useful Life 40
Replacement Year 47-48
Remaining Life 23



Fiberglass Refurbish Allow - Pool Slide - 2034

		1 Lump Sum	@ \$29,000.00
Asset ID	1020	Asset Actual Cost	\$29,000.00
		Percent Replacement	100%
Category	Swimming Pool	Future Cost	\$40,907.36
Placed in Service	June 2023		
Useful Life	12		
Replacement Year	34-35		
Remaining Life	10		



Community Advisors Page 5-42 May 18, 2024

Filtration Equip Allowance (partial replacement) - 2024

Asset ID	1025	1 Lump Sum Asset Actual Cost Percent Replacement	@ \$3,000.00 \$3,000.00 100%
Category	Swimming Pool	Future Cost	\$3,000.00
Placed in Service	June 2008		
Useful Life	1		
Replacement Year	24-25		
Remaining Life	0		



Filtration System Refurishment Allowance - 2042

Asset ID	1025	1 Lump Sum Asset Actual Cost Percent Replacement	@ \$30,000.00 \$30,000.00 100%
Category	Swimming Pool	Future Cost	\$55,724.67
Placed in Service	June 2008		
Useful Life	35		
Replacement Year	42-43		
Remaining Life	18		



Community Advisors Page 5-43 May 18, 2024

Pool Lift - 2032

Asset ID 1021 Asset Actual Cost \$5,642.00
Percent Replacement 100%
Category Swimming Pool Future Cost \$7,429.44

Placed in Service June 2021
Useful Life 12
Replacement Year 32-33
Remaining Life 8



Pool Resurfacing/Tile - 2026

Asset ID 1018 Asset Actual Cost \$117,640.0

Percent Replacement 1009

Category Swimming Pool
Placed in Service June 2015
Useful Life 12
Replacement Year 26-27
Remaining Life 2



Pool Splash Equipment Allowance - 2027

Asset ID	1017	1 Lump Sum Asset Actual Cost Percent Replacement	@ \$20,000.00 \$20,000.00 100%
Category	Swimming Pool	Future Cost	\$22,174.36
Placed in Service	June 2008		
Useful Life	20		
Replacement Year	27-28		
Remaining Life	3		



Refurbish Allowance - Pool Slide Frame - 2034

		1 Lump Sum	@ \$39,000.00
Asset ID	1024	Asset Actual Cost	\$39,000.00
		Percent Replacement	100%
Category	Swimming Pool	Future Cost	\$55,013.35
Placed in Service	June 2023		
Useful Life	12		
Replacement Year	34-35		
Remaining Life	10		



Community Advisors Page 5-45 May 18, 2024

Shade Fabric - Pool - 2047		3 Each	@ \$2,300.00
Asset ID	1022	Asset Actual Cost	\$6,900.00
		Percent Replacement	100%
Category Sv	vimming Pool	Future Cost	\$15,222.19
Placed in Service	April 2024		
Useful Life	14		
Adjustment	10		
Replacement Year	47-48		
Remaining Life	23		



Shade fabric scheduled for replacement in FY 2024 with projected life of 14 years which occurs at time of frame and fabric replacement (seperate component). After full replacement the next replacement cycle of fabric is projected to be FY 2047.

Shade Structure Replacement - 2033		3 Each	@ \$15,000.00
Asset ID	1023	Asset Actual Cost	\$45,000.00
		Percent Replacement	100%
Category	Swimming Pool	Future Cost	\$61,330.38
Placed in Service	June 2008		
Useful Life	26		
Replacement Year	33-34		
Remaining Life	9		

Shade Structure Replacement continued...



Structure and fabric replacement projected in FY 2033 as a one time replacement.

Splash Pad Equipment Allowance - 2047

	1 Lump Sum	@ \$42,000.00
	Asset Actual Cost	\$42,000.00
	Percent Replacement	100%
Swimming Pool	Future Cost	\$92,656.81
June 2023		
25		
47-48		
23		
	June 2023 25 47-48	Asset Actual Cost Percent Replacement Swimming Pool June 2023 25 47-48



Backflow Preventer Repair

Asset ID

Asset Actual Cost Percent Replacement Future Cost

100%

Category
Placed in Service
No Useful Life

Operating Expense June 2008



Electrical Panels/Disconnects

Asset ID

Asset Actual Cost Percent Replacement Future Cost

100%

Category Placed in Service No Useful Life Operating Expense June 2008



Fire Detection Devices

No Useful Life

Asset ID 1071 Asset Actual Cost

Category Operating Expense Future Cost
Placed in Service June 2008

Flag Pole

Asset ID Asset Actual Cost
Percent Replacement 100%
Category Operating Expense Future Cost

Category Operating Expense F
Placed in Service June 2008
No Useful Life



Grills

Asset ID Asset Actual Cost
Percent Replacement 100%

Category Operating Expense Future Cost
Placed in Service June 2008
No Useful Life

Grills continued...



Interior Painting - Clubhouse

Asset ID 1074

Category
Placed in Service
No Useful Life

Operating Expense June 2008

Asset Actual Cost Percent Replacement Future Cost

100%

Laminated Beam Repair

Asset ID

Category
Placed in Service
No Useful Life

Operating Expense June 2008

Asset Actual Cost Percent Replacement Future Cost

100%



Community Advisors Page 5-50 May 18, 2024

Message Board

Asset ID

Asset Actual Cost Percent Replacement Future Cost

100%

Category
Placed in Service
No Useful Life

Operating Expense June 2008



Painting - Entry Features

Asset ID 1081

Asset Actual Cost Percent Replacement

100%

Category Placed in Service No Useful Life Operating Expense June 2008

Future Cost

Painting - Pool Equipment Yard

Asset ID 1078 Asset Actual Cost \$0.85

Percent Replacement 100%
Category Operating Expense Future Cost \$0.85
Placed in Service June 2008

No Useful Life

Painting - Pool Equipment Yard continued...



Pendent Lights - Breezeway

Asset ID

Category Placed in Service No Useful Life Operating Expense June 2008

Asset Actual Cost Percent Replacement Future Cost

100%



Refrigerator

Asset ID

1034

Asset Actual Cost Percent Replacement Future Cost

100%

Category Placed in Service No Useful Life Operating Expense June 2008

Community Advisors Page 5-52 May 18, 2024

Refrigerator continued...



Splash Pad Coating/Repair

Asset ID

Category Placed in Service No Useful Life Operating Expense June 2008

Asset Actual Cost Percent Replacement Future Cost

100%



Sport Court Nets/Equipment

Asset ID

Category Placed in Service No Useful Life Operating Expense June 2008

Asset Actual Cost Percent Replacement Future Cost

100%

Sport Court Nets/Equipment continued...



Trash Cans/ Misc. Site Furnishings

Asset ID

Category Placed in Service No Useful Life Operating Expense June 2008

Asset Actual Cost Percent Replacement Future Cost

100%



Water Coolers - Clubhouse

Asset ID

1053

Asset Actual Cost Percent Replacement Future Cost

100%

Category Placed in Service No Useful Life Operating Expense June 2008

Community Advisors Page 5-54 May 18, 2024

Water Heater - Clubhouse

No Useful Life

Asset ID 1057 Asset Actual Cost Percent Replacement

100%

Category Operating Expense Future Cost
Placed in Service June 2008

Backflow Preventer Replacement

Asset ID Asset Actual Cost

Category Not Included Placed in Service June 2008 No Useful Life

Percent Replacement **Future Cost**

Future Cost

100%



Building Foundation/Frame

Asset ID 1071 **Asset Actual Cost** Percent Replacement 100%

Category Not Included Placed in Service June 2008 No Useful Life

Communication Wiring/Devices in Building

Asset ID 1071 Asset Actual Cost

Percent Replacement 100% Not Included **Future Cost** Category Placed in Service June 2008

No Useful Life

Electrical Wiring/Devices in Building

Asset ID 1071 Asset Actual Cost Percent Replacement

Category Not Included
Placed in Service June 2008

No Useful Life

Light Poles (Concrete) - Parking Lot

Asset ID 1071 Asset Actual Cost

Percent Replacement 100%
Category Not Included Future Cost

Category Not Included Placed in Service June 2008

No Useful Life

Siding/Trim Replacement

Asset ID 1071 Asset Actual Cost
Percent Replacement 100%

Category Not Included
Placed in Service June 2008
No Useful Life

Percent Replacement Future Cost

Future Cost

100%

~ .				
Site	IJ	til	iti	es

Asset ID 1071 Asset Actual Cost

100%

Category Not Included Future Cost
Placed in Service June 2008

No Useful Life

Water/Sewer/Vent Piping In building

Asset ID 1071 Asset Actual Cost

Percent Replacement 100%
Category Not Included Future Cost

Placed in Service June 2008
No Useful Life

Wood Pergolas - Entry Signs

Asset ID 1004 Asset Actual Cost Percent Replacement

100%

Category Components Removed Future Cost
Placed in Service June 2008

No Useful Life

Report Navigation

- **Executive Summary** provides information about projected year end reserve balance, current annual contribution, interest, and inflation rates:
 - Level of Service is the type of reserve study
 - Funding Method is either Component Funding or Pooled Cash
 - Component Funding Contribution is a year one only amount
 - Current Funding Plan currently used by the Association
 - Recommended Funding Plan maintains adequate funding
- **Funding Model Projections** include both your current plan and our recommended plan. The information included in each column is described below:
 - Year begins with your study year generally for a 30-year term
 - Current cost is the current replacement of all components
 - Annual contribution is the amount placed in reserves each year
 - Annual interest earned on your funds
 - Annual expenditures are the projected component replacement cost by year
 - Projected ending balance is the year end reserve fund balance
 - Fully funded reserves are the fully funded balance for that year. Fully Funded formula is Fully Funded Balance= Component cost x Age/Useful Life
 - Percent Funded is a measure of fund strength
- Current Funding Projection is your current funding plan and how it performs
- Recommended Funding Model Projection is the plan we recommend
- Cash Flow is a 30-year statement that provides both income and expense information to quickly find when expenditures occur and the resulting financial status of your reserves
- **Annual Expenditure Detail** provides a year to year list of your projected expenditures This is a good section to review each year when preparing your budgets
- Condition Assessment (if included) is a brief description of major component condition
- **Component Inventory** contains a list of your components, remaining useful life and quantities we determined from our site visit and other means of measurement
- Component Detail Index allows quick access to the detail we have included for each component separated into categories
- Component Detail provides a listing of each component, quantities or allowances and photographs of major ones
- Methodology Terms of Service Company Profile are our Disclosure sections with information about our assumptions, methods of work and our credentials

METHODOLOGY

Reserve Analysis is a process that identifies capital expenses the District can expect and creates a plan to fund them. This is accomplished by a site visit to visually evaluate components to measure quantities and determine their remaining life. Component Selection Process is based on the Community Associations Institute (CAI) standards for reserve studies and selection of components.

Component must be a commonly owned, have a limited and predictable life, replacement cost must be above a minimum threshold cost. Useful life and replacement cost are obtained from site inspection by experienced inspectors and our database of information, historical information, local Vendors and comparison of similar component cost found at other properties.

The funding plan we develop includes; adequate cash balances, even contributions so all owners pay their fair share over time and moderate contributions with acceptable increases. Percent Funded is defined by industry standards as 70-100% strong, 30-70% fair or adequate and below 30% weak or inadequate. <u>Baseline Funding</u> maintains funds above zero resulting is a high risk of special assessments or deferred maintenance and should be avoided. Threshold Funding maintains reserves above a "Threshold" level providing adequate funding with moderate risk; using this method requires regular analysis updates.

CREDENTIALS

Community Advisors, LLC provides capital reserve planning, property inspection, and construction oversight for a broad base of clients including High-rise Condominiums, Homeowner Associations, Churches, Private Schools, Time Shares, Active Adult, Municipal Utility Plants, Marinas, Historic Buildings & Museums and commercial investment properties.

Personal Service attention to detail, quick response and valued client relationships.

Range of Experience includes a broad selection of building types, ages and uses from protected historic structures to new communities ready for developer turnover. As commercial general contractors we have experience building many of the types of structure we now provide reserve analysis for, so we understand potential problem areas. As commercial inspectors we have experienced a variety of structural and cosmetic conditions offering solutions for repair. Areas of expertise include MEP systems, energy management, life safety systems, building envelope and roof components, marine structures, street and other site improvements.

Detailed Site Evaluation is Conducted to make sure we know your property and include all your assets in our analysis. With our years of experience with community development and commercial construction projects we understand both horizontal and vertical construction and utilize realistic replacement cost and useful life projections in our analysis. Financial Plan Meets CAI & APRA Standards with information obtained during the site visit we build a custom-made financial plan to ensure adequate funding for future component replacement which equates to maintaining community value.

Reserve Analyst Credentials: Mr. Charles Sheppard is the owner of Community Advisors responsible for field inspection oversight and day to day operations. Mr. Sheppard hold a BS degree from VA Tech and has conducted building evaluations for over 30 years. He is a licensed Florida General Contractor, Home Inspector and earned the professional designations of Certified Construction Inspector (CCI), Professional Reserve Analyst (PRA) and Reserve Specialist (RS).

TERMS OF SERVICE

We have completed an analysis of your capital components that serves as a budgeting tool. This reserve study reflects the information provided by this client and is not for the purposes of performing an audit or estimating construction projects. Our site visit includes visual observation of components that are accessible and safe for our inspectors to evaluate. Roof evaluation is limited to ground observation for sloped roofs and roof top inspection for flat roofs if safe and stable access is available that meets our safety standards.

We are not responsible for any hidden defects or determining the condition of hidden or underground components or systems. Observing environmental conditions, hazardous materials or determine compliance with building codes or other regulations is not included in our scope of work. Our site visit is not a safety inspection and we are not responsible for any hazards that exist. Destructive testing is not conducted. It has been assumed, unless otherwise noted in this report, that all assets have been designed and constructed properly and that each estimated useful life will approximate that of the norm per industry standards and/or manufacturer's specifications.

Projections of component remaining useful life assumes this client will perform necessary preventative maintenance and repair per industry standards. This reserve analysis study and the parameters under which it has been completed are based upon information provided to us in part by the Client and its contractors, assorted vendors, specialist and independent contractors. Reserve fund balances and contribution amounts for use in our analysis is furnished by the client and deemed accurate. Useful life projections are determined by historical records, component condition and our opinion based on evaluating similar components on other projects. These life projections are changed by weather conditions, use, maintenance procedures and other factors out of our control therefore regular updates to this analysis are needed to maintain funding accuracy. Replacement cost is determined by our experience with similar projects, local vendor pricing and client historical records and should not be considered suitable for budgeting repair or replacement projects. Local contractor proposals must be obtained for this work. No liability is assumed as the result of changing market prices or inaccurate estimates or projections of remaining useful life of components.

Component replacement cost and interest rates constantly change. In order to maintain accuracy of your funding plan updates to this analysis should be conducted annually with a site visit every 2-3 years unless conditions warrant annual visits. Community Advisors, LLC shall not be required to participate in any legal action taken by or against our clients for any reason and shall also not be required to give testimony in depositions or in court. In all cases the liability of Community Advisors, LLC and its Principals, Employees, contractors and Vendors shall be limited to the consulting fee agreed upon for the production of this report. Client financial information is considered confidential and is not disclosed to third parties without your approval. We do use your name for our list of valued clients and when submitting proposals for new projects that request references or recent projects. That request may include size of property, number of units or major components. We also use photos from time to time of components as an example for educational and marketing efforts. Community Advisors and the analyst who prepared this study do not have any relationship that can be considered a conflict of interest. From time to time our Clients ask that we manage repair or replacement of components due to our experience in construction management. We do so with the understanding that full disclosure for both parties is completed.

DEFINITIONS

Adjustment to Useful Life: Typical useful life projections are used for each component. The adjustment is used to modify that life projection for earlier or later replacement. It only applies to the current replacement cycle.

Cash Flow Method: A method of determining reserve contributions that are "pooled" to fund replacement cost as needed without restricting funds to any one component.

Component Method: A funding method that fully funds each reserve component then sums those for the annual contribution.

Current Funding Plan: The funding plan currently used at the time of this analysis with updated component inventory and financial assumptions. This allows you to see how the current contribution level funds future component replacement.

Effective Age: Difference of useful and remaining useful life.

Fully Funded Balance: Represents the cost of used component life represented by the formula.

FFB = (Current Cost x Effective Age)/ Useful Life

Interest Contribution: The interest that should be earned on invested reserves.

Percent Funded: Ratio of reserve balance to fully funded balance.

Remaining Life: Number of years a component is projected to continue to function.

Threshold Funding: This plan maintains fund balance above a predetermined threshold dollar or percent funded amount.

Useful Life: The estimated useful life of an asset based upon industry standards, manufacturer specification, visual inspection, location, usage, association standards and prior history.